

SQUARE ONE HOME INSPECTIONS LLC

5037184719 charles@square1az.com https://www.square1az.com



RESIDENTIAL REPORT

12366 W Milton Dr Peoria AZ 85383

> Charles Mertz JULY 15, 2019



Inspector
Charles Drown

Arizona BTR Licensed Inspector
5037184719
charles@square1az.com



Agent
Donald Host
Lux Home Group Keller Williams
6234514018
don@luxhomegroup.com

Table of Contents

Table of Contents	2
SUMMARY	3
1: INSPECTION DETAILS	5
2: BUILT-IN APPLIANCES	6
3: STRUCTURAL COMPONENTS	9
4: EXTERIOR	13
5: ROOFING	21
6: PLUMBING	25
7: ELECTRICAL	35
8: HEATING	40
9: COOLING	42
10: INTERIORS	49
11: INSULATION, VENTILATION	53
STANDARDS OF PRACTICE	56

SUMMARY









ITEMS INSPECTED

NOTEWORTHY ITEM/ DIY

RECOMMENDATION

SAFETY HAZARD

- 2.3.1 Built-in Appliances Range/Oven/Cooktop: Burner Not Lighting Gas
- 3.1.1 Structural Components 6) Foundation: Evidence of Wood Destroying Organisms
- 4.1.1 Exterior 13) Wall Cladding: Crack/s in Stucco Minor
- 4.3.1 Exterior 15) Entry Doors: Double-Keyed Deadbolt
- 4.9.1 Exterior 21) Vegetation: Tree Debris on Roof
- 4.9.2 Exterior 21) Vegetation: Tree/Shrubs/Bushes Touching Dwelling
- 4.10.1 Exterior 22) Grading, Drainage: Animal Enclosure?
- 4.11.1 Exterior 23) Patio, Walks, Driveway: Walkway Trip Hazard
- 5.1.1 Roofing 25) Roof Coverings: Cracked Tiles Multiple
- 5.2.1 Roofing 26) Drainage Systems*: Debris
- 6.4.1 Plumbing 32) Fixtures, Faucets: Fixtures Corroded
- 6.4.2 Plumbing 32) Fixtures, Faucets: Fixtures Loose Or Broken
- 6.4.3 Plumbing 32) Fixtures, Faucets : Toilet/s Loose
- 6.4.4 Plumbing 32) Fixtures, Faucets: Shower Grout Deteriorated
- 6.4.5 Plumbing 32) Fixtures, Faucets: Reverse Osmosis shut off
- ♠ 6.7.1 Plumbing 35) Cross Connections*: No High-Loop On Dishwasher
- 6.10.1 Plumbing 38) Functional Drainage: Poor/Slow Drainage
- 6.11.1 Plumbing 39) Water Heating Equipment And Controls: Corrosion On Shutoff Valve
- 7.9.1 Electrical 52) Lights, switches: Light Inoperable
- 7.9.2 Electrical 52) Lights, switches: Ceiling Fan Unbalanced
- 9.1.1 Cooling 64) Cooling Equipment: Insulation Damaged/Missing
- 9.1.2 Cooling 64) Cooling Equipment: R-22 Refrigerant
- 9.1.3 Cooling 64) Cooling Equipment: Service A/C
- 9.4.1 Cooling 67) Distribution System : Ductwork Damaged
- 9.5.1 Cooling 68) Air Filters: Filter Dirty
- 10.1.1 Interiors 70) Walls, Ceilings, Floors: Moisture Damage Wall/s
- 10.1.2 Interiors 70) Walls, Ceilings, Floors: Interior General damage
- 10.4.1 Interiors 73) Counters, Cabinetry: Cabinets & Countertops General Wear

○ 10.6.1 Interiors - 75) Windows : Window/s - Does not Latch/Lock

1: INSPECTION DETAILS

Information

Type of Building

Single Family

Occupancy Vacant

Clear, Dry, Hot

Weather Conditions

Temperature (approximate)

109 Fahrenheit (F)



2: BUILT-IN APPLIANCES

		IN	NI	NP	0
2.1	Dishwasher	Χ			
2.2	Refrigerator	Χ			
2.3	Range/Oven/Cooktop	Χ			
2.4	Microwave	Χ			
2.5	Garbage Disposal	Χ			
2.6	Washing Machine	Χ			
2.7	Dryer	Χ			

IN = Inspected

NI = Not Inspected

NP = Not Present

O = Observations

Information

Dishwasher: Condition Satisfactory Where Visible

Range/Oven/Cooktop: Exhaust **Hood Type** Vented



Microwave: Condition Satisfactory

Refrigerator: Condition Satisfactory Where Visible

Satisfactory with exceptions listed below

Range/Oven/Cooktop: **Range/Oven Energy Source** Electric, Gas

Range/Oven/Cooktop: Condition Microwave: Brand Kitchenaid



Garbage Disposal: Brand Garbage Disposal: Condition Kitchen Satisfactory Where Visible Badger



Dishwasher: Brand

Frigidaire







Refrigerator: Brand

KitchenAid





Range/Oven/Cooktop: Range/Oven Brand

Kitchenaid





Washing Machine: Brand

Not Present





Dryer: BrandNot Present







Electric & Gas Options

Electric



Gas

Observations

2.3.1 Range/Oven/Cooktop

Recommendation

BURNER NOT LIGHTING - GAS

One or more of the gas burners on the range would not light. Recommend qualified appliance repair man evaluate & repair.

Recommendation

Contact a qualified appliance repair professional.



3: STRUCTURAL COMPONENTS

		IN	NI	NP	0
3.1	6) Foundation	Χ			
3.2	7) Floor Structure	Χ			
3.3	8) Wall Structure	Χ			
3.4	9) Columns	Χ			
3.5	10) Roofs/Ceiling Structure	Χ			
3.6	11) Under Floor Crawlspace*	Χ		Χ	
3.7	12) Observation Method	Χ			

IN = Inspected

NI = Not Inspected

NP = Not Present

O = Observations

Information

6) Foundation: ConditionSatisfactory-Inspection Limited

8) Wall Structure: TypeWood Framed, Concrete

9) Columns: ConditionSatisfactory Where Visible

12) Observation Method :

Observed From

Partial Attic Accesed, Interior Of Residence, Exterior Of Residence

7) Floor Structure: Type Framed, Concrete

8) Wall Structure: ConditionSatisfactory Where Visible

10) Roofs/Ceiling Structure:ConditionSatisfactory


7) Floor Structure: ConditionSatisfactory Where Visible

9) Columns: Type Undetermined

11) Under Floor Crawlspace*:ConditionNot Present

6) Foundation: Type

Post Tension Slab on Grade

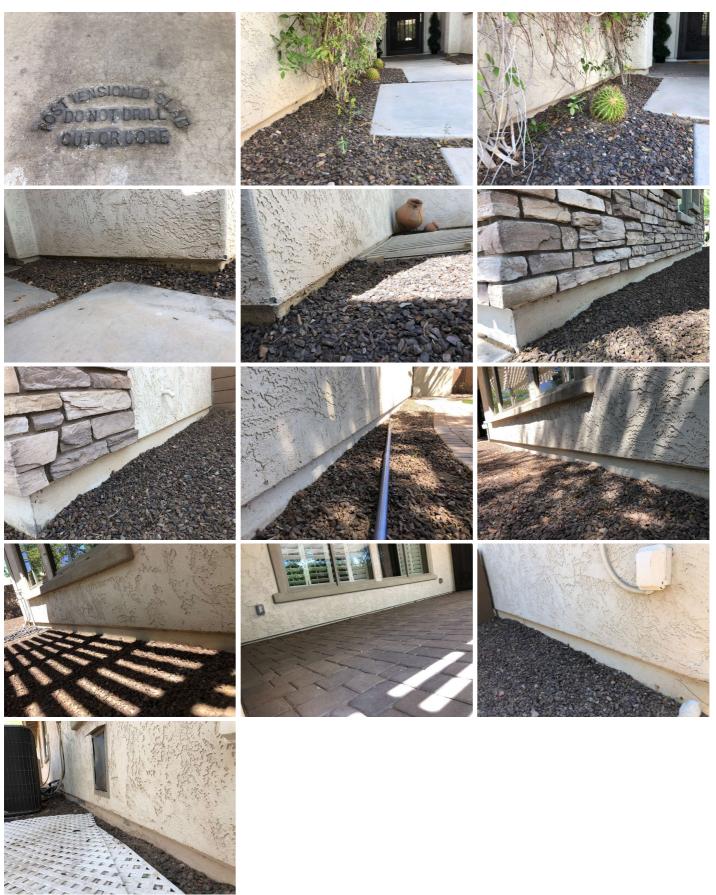

10) Roofs/Ceiling Structure: Type

Truss System




Limitations

6) Foundation

BASEMENT

Because there is a basement in the home sections of the foundation are not visible and are considered below grade. For this reason the inspection of the foundation is limited.

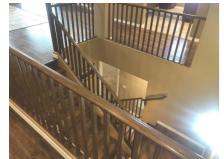



Observations

3.1.1 6) Foundation

EVIDENCE OF WOOD DESTROYING ORGANISMS



There is evidence that suggest wood destroying organisms are present/were present at the time of the inspection. Recommend a Termite Inspector further evaluate and recommend treatment.

Recommendation

Contact a qualified pest control specialist.









4: EXTERIOR

		IN	NI	NP	0
4.1	13) Wall Cladding	Χ			
4.2	14) Flashing And Trim	Χ			
4.3	15) Entry Doors	Χ			
4.4	16) Windows	Χ			
4.5	17) Garage Door Opener	Χ			
4.6	18) Decks, Balconies, Steps	Χ			
4.7	19) Porch, Areaway, Railings	Χ			
4.8	20) Eaves, Soffits, Fascia	Χ			
4.9	21) Vegetation	Χ			
4.10	22) Grading, Drainage	Χ			
4.11	23) Patio, Walks, Driveway	Χ			
4.12	24) Retaining Walls	Χ		Χ	

IN = Inspected

NI = Not Inspected

NP = Not Present

O = Observations

Information

13) Wall Cladding: Condition Satisfactory Where Visible

15) Entry Doors: Operation Operational

17) Garage Door Opener: Door **Opener Operation** Operational

18) Decks, Balconies, Steps: Step 19) Porch, Areaway, Railings: Condition Not Present

14) Flashing And Trim: Flashing 14) Flashing And Trim: Trim Condition

Satisfactory Where Visible

16) Windows : Operation Operational

18) Decks, Balconies, Steps: **Balcony Condition** Not Present

Areaway Condition Satisfactory

Condition

Satisfactory Where Visible

16) Windows: Condition Fair

18) Decks, Balconies, Steps: Deck Condition Not Present

19) Porch, Areaway, Railings: **Porch Condition** Not Present



19) Porch, Areaway, Railings: **Railing Condition** Not Present

21) Vegetation: Adverse Effect **On Structure**

22) Grading, Drainage: Drainage Condition Satisfactory

22) Grading, Drainage: Grading Condition

Satisfactory

23) Patio, Walks, Driveway: Condition

Satisfactory With Exception/s Listed Below

23) Patio, Walks, Driveway: No Adverse Effect On Structure Observed

24) Retaining Walls: Condition

Satisfactory

13) Wall Cladding: Type Stucco, Stone Vaneer









15) Entry Doors: ConditionSatisfactory With Exceptions Listed below







17) Garage Door Opener: Garage Door ConditionSatisfactory





17) Garage Door Opener: Door Opener/s ConditionSatisfactory





19) Porch, Areaway, Railings: Gate/s ConditionSatisfactory






20) Eaves, Soffits, Fascia: Eve ConditionSatisfactory








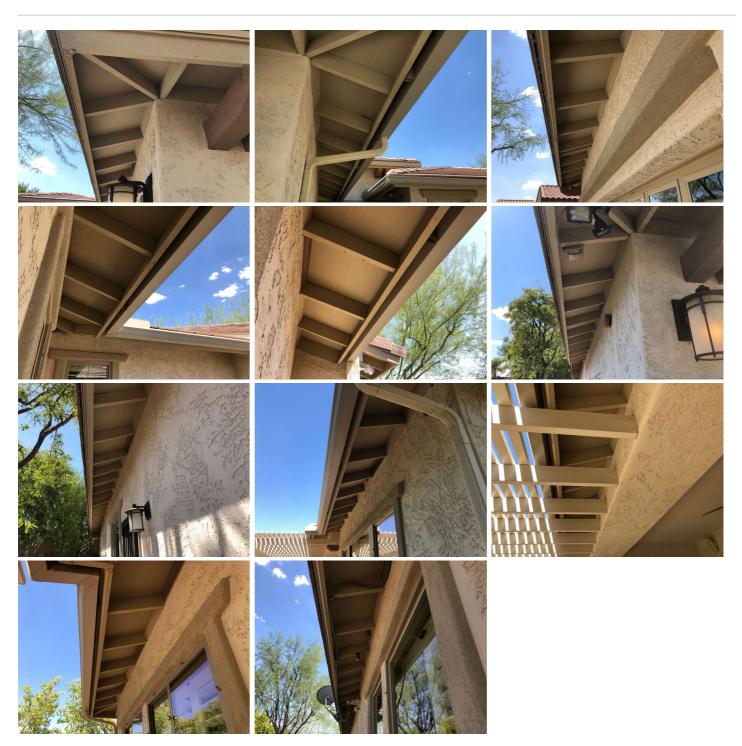

20) Eaves, Soffits, Fascia: Fascia ConditionSatisfactory

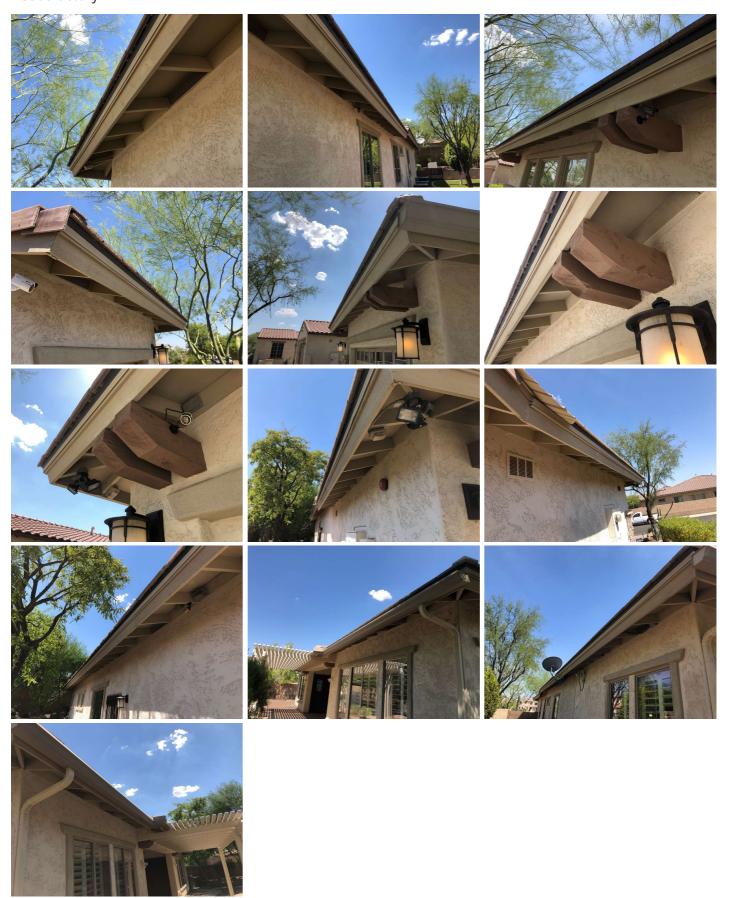

20) Eaves, Soffits, Fascia: Soffit Condition

Satisfactory







24) Retaining Walls: TypeBrick






Observations

4.1.1 13) Wall Cladding

CRACK/S IN STUCCO - MINOR

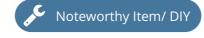

Siding showed cracking in one or more places. This is typically a result of temperature changes or settling, which is normal with homes clad in stucco. At this time it should be considered cosmetic and we recommend monitoring. Seal and paint as desired.

Recommendation

Recommended DIY Project



4.3.1 15) Entry Doors


DOUBLE-KEYED DEADBOLT

The deadbolt on one or more of the entry doors has a deadbolt that is keyed on the inside. Thi is a safety hazard in the case of an emergency. Recommend correction or replacement by liscenced contractor or DIY.



Recommendation

Contact a qualified door repair/installation contractor.

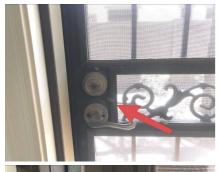





4.9.1 21) Vegetation

TREE DEBRIS ON ROOF



Tree debris observed on roof. This can cause improper drainage to gutters, downspouts, valleys and other parts of the roof. Recommend clearing debris.

Recommendation

Contact a qualified handyman.





4.9.2 21) Vegetation

Recommendation

TREE/SHRUBS/BUSHES TOUCHING DWELLING

Trees/Shrubs observed coming in contact with the dwelling. This can be a pathway for insects and should be Trimmed back at least 1 foot from touching any section of the residence. Recommend all work be done by licensed tree trimming contractor.

Recommendation

Contact a qualified tree service company.



4.10.1 22) Grading, Drainage

ANIMAL ENCLOSURE?



Recommendation

Recommended DIY Project



4.11.1 23) Patio, Walks, Driveway

WALKWAY - TRIP HAZARD



At the time of the inspection there was one or more trip hazard observed. Recommend corrections be made by licensed Contractor.

Recommendation

Contact a qualified professional.



5: ROOFING

		IN	NI	NP	0
5.1	25) Roof Coverings	Χ			
5.2	26) Drainage Systems*	Χ			
5.3	27) Flashings/ Penetrations, Skylights*, Chimneys*	Χ			
5.4	28) Evidence Of Leaking *	Χ			
5.5	29) Method Used To Observe	Χ			

Information

25) Roof Coverings: ConditionSatisfactory (Minor Damage)


26) Drainage Systems*:ConditionNot Satisfactory

28) Evidence Of Leaking *: No Evidence Of Leaking Observed


29) Method Used To Observe : Method Of Observation Walked

25) Roof Coverings: Type

Concrete Tile

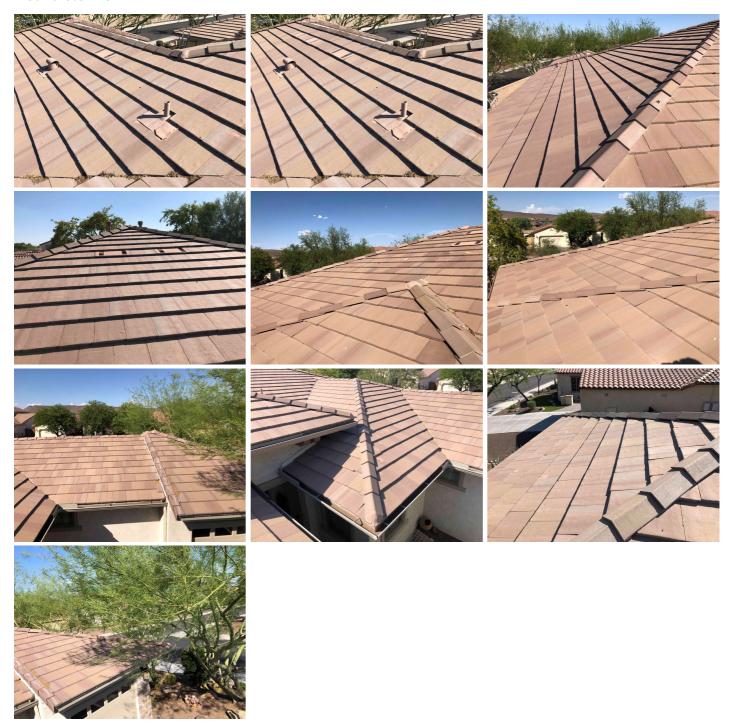

27) Flashings/ Penetrations, Skylights*, Chimneys*: ConditionSatisfactory Where Visible

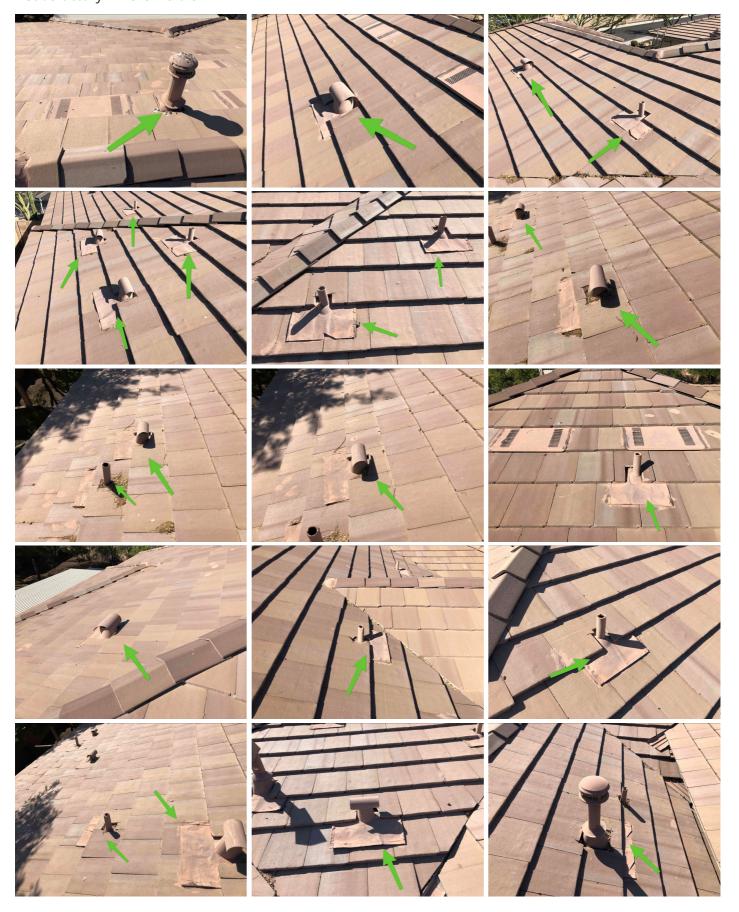

Observations

5.1.1 25) Roof Coverings

CRACKED TILES - MULTIPLE



One or more cracked tiles were found on the roof. We recommend they be repaired or replaced by a licensed roofing contractor to prevent moisture and sun damage to roof structure.

Recommendation

Contact a qualified roofing professional.





5.2.1 26) Drainage Systems*



DEBRIS

Debris has accumulated in the gutters. Recommend cleaning to facilitate water flow.

Recommendation

Contact a qualified roofing professional.







Charles Mertz 12366 W Milton Dr

6: PLUMBING

		IN	NI	NP	0
6.1	General Info (Plumbing)	Χ			
6.2	30) Interior Supply/ Distribution Piping	Χ			
6.3	31) Supports, Insulation	Χ			
6.4	32) Fixtures, Faucets	Χ			
6.5	33) Functional Flow	Χ			
6.6	34) Water Supply Leaks	Χ			
6.7	35) Cross Connections*	Χ			
6.8	36) Waste And Vent Piping System	Χ			
6.9	37) Drain Leaks	Χ			
6.10	38) Functional Drainage	Χ			
6.11	39) Water Heating Equipment And Controls	Χ			
6.12	40) Automatic Saftey Controls	Χ			
6.13	41) Flues And Vents	Χ			
6.14	42) Fuel Storage And Fuel Distribution System And Supports	Χ			

IN = Inspected

NI = Not Inspected

NP = Not Present

O = Observations

Information

General Info (Plumbing): Main Water Shut-Off Device (Location) Pressure (Approximate)

Exterior

Piping: Type

Copper, Unknown

General Info (Plumbing): Water

75



Piping: Condition

Satisfactory Where Visible





General Info (Plumbing): Main Fuel Shut-Off (Location) Exterior



30) Interior Supply/ Distribution **Piping: Water Softener** Not Present



Plumbed but not installed

32) Fixtures, Faucets: Faucets

Satisfactory with Exceptions

35) Cross Connections*: Coss

and Fixtures - Condition

Connection/s Observed

Listed Below

31) Supports, Insulation: Condition Satisfactory Where Visible

32) Fixtures, Faucets: Toilet-**Operation** Operational

36) Waste And Vent Piping System: Waste and Vent -Condition Satisfactory

32) Fixtures, Faucets: Faucets and Fixtures - Operation Operational

34) Water Supply Leaks: Supply

No Supply Leaks Were Observed

System: Sump Pumps Basement Satisfactory

36) Waste And Vent Piping

36) Waste And Vent Piping **System:** Sump Pump - Condition Satisfactory



36) Waste And Vent Piping **System:** Sewage Ejector Pump/s Basement Satisfactory

36) Waste And Vent Piping System: Sewage Ejector Pump -Condition Satisfactory



37) Drain Leaks: Evidence Of Leaking

No Evidence Of Leaking Observed

39) Water Heating Equipment **And Controls: Power Source**

Gas

39) Water Heating Equipment And Controls: Age of Unit/s -**Approximate**

2



P-2017, D-April

39) Water Heating Equipment **And Controls: Capacity**

50 Gallons



39) Water Heating Equipment **And Controls: Location**

Garage



39) Water Heating Equipment **And Controls : Condition**

Satisfactory Where Visible

40) Automatic Saftey Controls: Thermocouple Satisfactory



41) Flues And Vents: Flue Pipe -Condition

Satisfactory

41) Flues And Vents: Combustion 41) Flues And Vents: Combustion **Air Vents Present**



Air Vent - Condition

Satisfactory

42) Fuel Storage And Fuel Distribution System And Supports: ConditionSatisfactory Where Visible




32) Fixtures, Faucets : Toilet/s - ConditionSatisfactory with exceptions listed below







33) Functional Flow: Functional FlowFunctional Flow Observed at All Fixtures

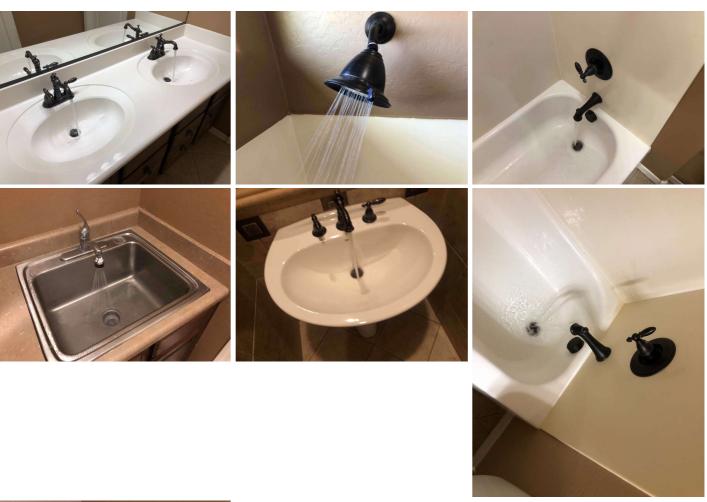



36) Waste And Vent Piping System: Waste and Vent - Type ${\sf ABS}$



38) Functional Drainage: Drainage Condition

Drainage Was Functional with Exceptions Listed Below

Functional Drainage is determined by running the water/fixture, in a way that simulates normal usage of the drains. In most cases this includes fully cycling the toilet, or running water down the drain for a period of time to ensure the drains are functioning normally.










39) Water Heating Equipment And Controls : ManufacturerBradford & White

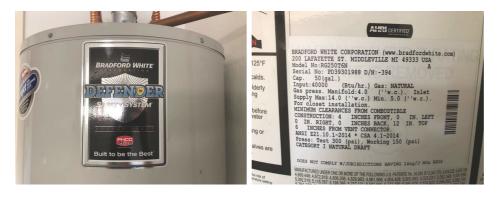

40) Automatic Saftey Controls: TPR Satisfactory



41) Flues And Vents: Flue Pipe/s - Type

Single Wall, Double Wall





Observations

6.4.1 32) Fixtures, Faucets

FIXTURES CORRODED



The fixtures in the residence are corroded and show signs of age. Although currently operational, they may be near the end of their life expectancy. Reccomend replacement or correction as desired by a licensed Plumber.

Recommendation

Contact a qualified plumbing contractor.











6.4.2 32) Fixtures, Faucets

FIXTURES LOOSE OR BROKEN



One or more of the fixtures in the residence is loose or broken. We recommend a licensed Plumber or Handyman repair or correct these issues.

Recommendation

Contact a qualified plumbing contractor.





6.4.3 32) Fixtures, Faucets



TOILET/S LOOSE

One or more toilets in the residence are loose or improperly secured. Reccomend further evaluation be made by licensed Handyman or Plumber

Recommendation

Contact a qualified plumbing contractor.



1st Floor Hall Bathroom

6.4.4 32) Fixtures, Faucets

SHOWER GROUT - DETERIORATED



One or more of the showers grout for the tile was deteriorated or in need of repair/correction. Recommend a full evaluation of all shower grout tile seems, and all work be done by licensed tile/bathroom contractor.

Recommendation

Contact a qualified general contractor.









6.4.5 32) Fixtures, Faucets


REVERSE OSMOSIS - SHUT OFF



There is a reverse osmosis water filter ration system in the residence. At the time of the inspection it was shut off, this could be because of a leak or not in service. Recommend contacting seller for more information, or having a licensed plumbing contractor repair/correct as needed.

Recommendation

Contact a qualified professional.

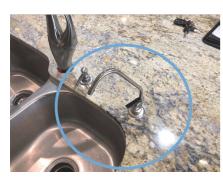



6.7.1 35) Cross Connections*

NO HIGH-LOOP ON DISHWASHER





There was no visible high-loop installed on the residences dish washer at the time of the inspection. We recommend a high-loop be installed by a qualified professional to ensure waste water does not enter back into the dishwasher.

Recommendation

Contact a handyman or DIY project



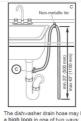

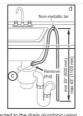

a high loop in one of two ways:

- Connect to the under sink dishwasher drain connection (25c).

Connect to the under SINK dishwasher drain connection (25c Connect to a disposer dishwasher drain connection (25d).

24

6.10.1 38) Functional Drainage

Recommendation

POOR/SLOW DRAINAGE

Poor/slow drainage was observed at one or more sinks or tubs at the time of the inspection. Recommend a qualified plumber evaluate and repair.

Recommendation

Contact a qualified plumbing contractor.



Basement Bathroom

6.11.1 39) Water Heating Equipment And Controls



CORROSION ON SHUTOFF VALVE

There appears to be corrosion on the shut off valve for the water heater. This usually indicates a past or present leak, however it appeared to not be leaking at the time of the inspection. Recommend repair or replacement by a licensed contractor.

Recommendation

Contact a qualified plumbing contractor.



7: ELECTRICAL

		IN	NI	NP	0
7.1	43) Service Type	Χ			
7.2	44) Service Conductor	Χ			
7.3	45) Service Ground	Χ			
7.4	46) Overcurrent protection devices	Χ			
7.5	47) Main and distribution panels	Χ			
7.6	48) Service amperage/voltage	Χ			
7.7	49) Branch circuit conductors	Χ			
7.8	51) Compatibility	Χ			
7.9	52) Lights, switches	Χ			
7.10	53) Receptacles, polarity, ground	Χ			
7.11	54) Ground fault interrupters	Χ			

IN = Inspected

NI = Not Inspected

NP = Not Present

O = Observations

Information

43) Service Type: ConditionSatisfactory Where Visible

46) Overcurrent protection devices: ConditionSatisfactory Where Visible

44) Service Conductor : ConditionSatisfactory Where Visible

47) Main and distributionpanels: Panel Manufacturer
Cutler Hammer



45) Service Ground: Ground Present

47) Main and distribution panels: Panel Locations Exterior



47) Main and distribution panels: ConditionSatisfactory Where Visible

48) Service amperage/voltage: Service Amperage Or Voltage Rating 200 AMP

49) Branch circuit conductors:ConditionSatisfactory



Not Present

52) Lights, switches: OperationObserved Switches Are
Operational

51) Compatibility: Acceptable/ Consistent With The Age Of The Home

53) Receptacles, polarity, ground: ConditionSatisfactory Where Visible

52) Lights, switches: ConditionSatisfactory with Exceptions
Listed Below

53) Receptacles, polarity, ground: OperationA Representative Amount Of Outlets Operate Normally

54) Ground fault interrupters :

ConditionSatisfactory

43) Service Type: Type Underground








44) Service Conductor: Type

Copper



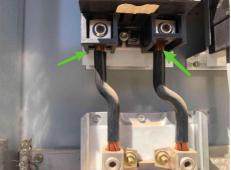






45) Service Ground: ConditionNot Visible (Non-Metallic Pipe)





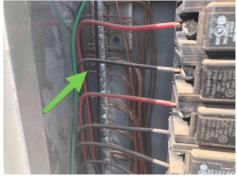

46) Overcurrent protection devices: Type

Circuit Breaker








49) Branch circuit conductors: Type

Copper

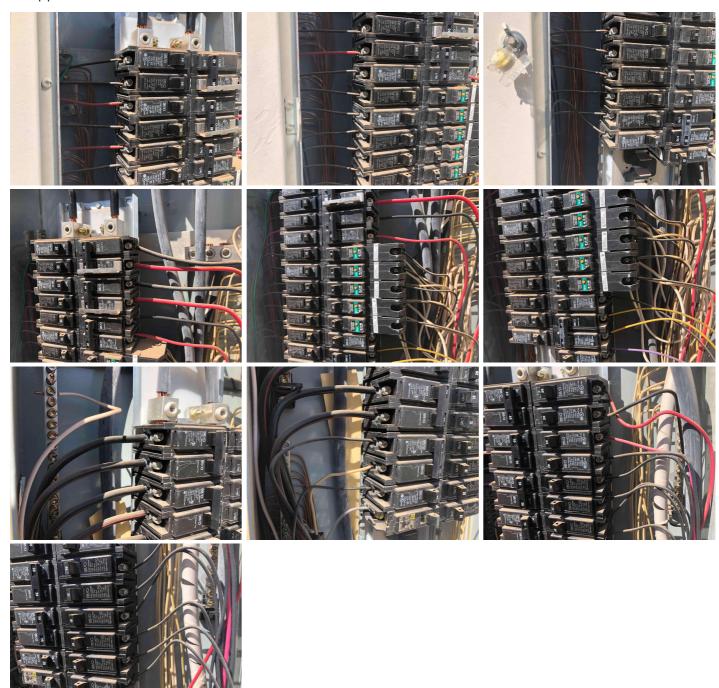

Observations

7.9.1 52) Lights, switches

LIGHT INOPERABLE


One or more lights are not operating. New light bulb possibly needed.

Recommendation

Contact a qualified electrical contractor.





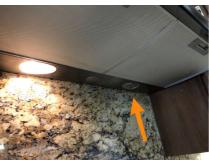

7.9.2 52) Lights, switches

Noteworthy Item/ DIY

CEILING FAN - UNBALANCED

At the time of the inspection one or more of the ceiling fans in the residence was unbalanced. Recommend correction/replacement by licensed electrician.

Recommendation

Contact a qualified electrical contractor.





Living Room

8: HEATING

		IN	NI	NP	0
8.1	55) Heating equipment	Χ			
8.2	56) Energy Source	Χ			
8.3	57) Operating Controls (thermostat)	Χ			
8.4	58) Automatic safety controls	Χ			
8.5	59) Chimneys, flues and vents	Χ			
8.6	60) Solid fuel heating devices	Χ		Х	
8.7	61) Distribution system	Χ			
8.8	62) Air filters	Χ			
8.9	63) Heat source	Χ			

IN = Inspected

NI = Not Inspected

NP = Not Present

O = Observations

Information

55) Heating equipment: Brand

Lennox

57) Operating Controls (thermostat): Condition Satisfactory (Operable)

60) Solid fuel heating devices:

Type

N/A Not Present

62) Air filters: Condition

Satisfactory

55) Heating equipment: Heating 56) Energy Source: Energy

Equipment - Condition

Satisfactory Inspection Limited

58) Automatic safety controls:

Auto-Saftey Control Condition

Satisfactory Where Visible

61) Distribution system:

Ductwork Type

Flex Ductwork

63) Heat source: Heat Source In

Every Room

Source

Natural Gas

60) Solid fuel heating devices:

Condition

Not Present


61) Distribution system:

Condition

Satisfactory Where Visible

55) Heating equipment: Heat Type

Gas-Fired Heat

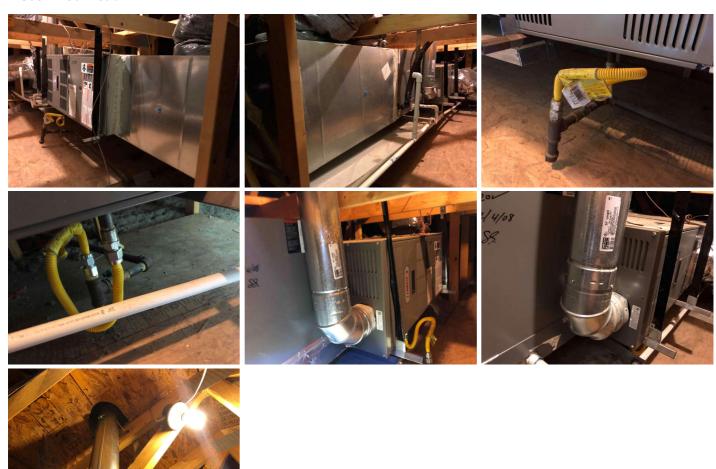

59) Chimneys, flues and vents: Condition

Satisfactory Where Visible



9: COOLING

		IN	NI	NP	0
9.1	64) Cooling Equipment	Χ			
9.2	65) Energy Source	Χ			
9.3	66) Operating Controls	Χ			
9.4	67) Distribution System	Χ			
9.5	68) Air Filters	Χ			
9.6	69) Cooling Source	Χ			

IN = Inspected

NI = Not Inspected

NP = Not Present

O = Observations

Information

64) Cooling Equipment: Condition

68) Air Filters: Condition

Fair

Satisfactory Where Visible

65) Energy Source: Energy Source

Electric



69) Cooling Source: Cooling Source Present In Every Room

67) Distribution System : Condition

Satisfactory With Exceptions Listed Below

64) Cooling Equipment: Brand

Lennox









64) Cooling Equipment: TypeAir Conditioner













Unit 2 Unit 3

64) Cooling Equipment: Age Of Unit/s (Approximate)








08-year, H-month (august)


08-year, H-Month (august)

08-year, H-Month (august)

64) Cooling Equipment: Approximate Temperature Differentials

72 - 62 Degrees

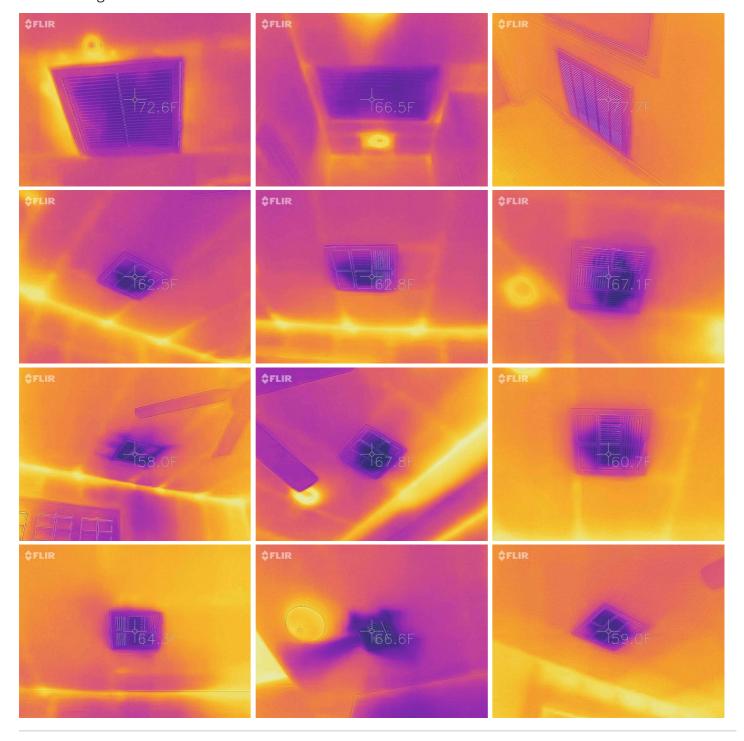

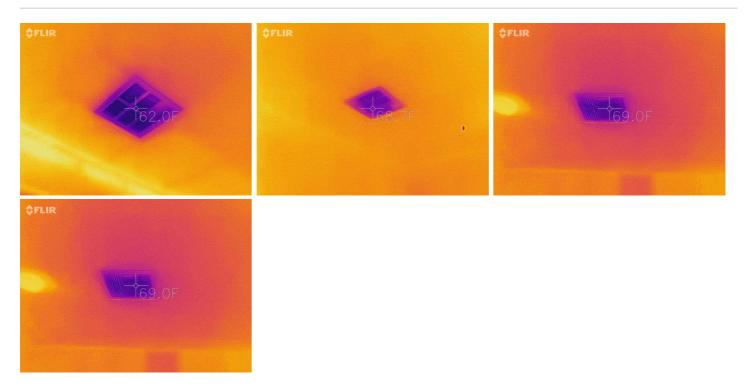

66) Operating Controls: ConditionSatisfactory(Operable)








Unit 1 Unit 2 Unit 3

67) Distribution System: Ductwork - Type

Flex Ductwork

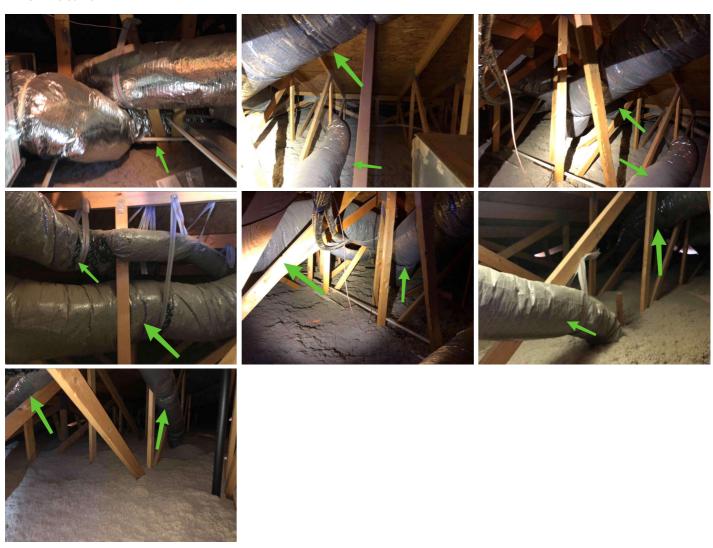

Observations

9.1.1 64) Cooling Equipment

INSULATION DAMAGED/MISSING



The insulation on the refrigerant lines for the AC unit is damaged/missing. Recommend correction be made by licensed professional.

Recommendation

Contact a qualified professional.










9.1.2 64) Cooling Equipment

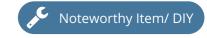

R-22 REFRIGERANT

One or more of the A/C units in for the residence operates with R-22 refrigerant. This type of refrigerant is has become obsolete and costly to replace. At this time we recommend further evaluation of the unit/s and information be provided by a licensed HVAC Contractor.

Recommendation

Contact a qualified HVAC professional.







Unit 1 Unit 2 Unit 3



9.1.3 64) Cooling Equipment

Noteworthy Item/ DIY


SERVICE A/C

Because of the age and condition of the AC unit/s in the residence, we recommend all AC units be serviced annually to maintain efficiency and longevity of the unit/s.

Recommendation

Contact a qualified HVAC professional.

9.4.1 67) Distribution System

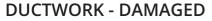



At the time of the inspection there were sections of the AC ductwork that was damaged/in need of repair. All repairs should be made by licensed HVAC Contractor.

Recommendation

Contact a qualified HVAC professional.



Under air handler in Basement

9.5.1 68) Air Filters

FILTER DIRTY



At the time of the inspection one or more of the air filters for the HVAC or dirty or in need of replacement. These should be replaced monthly, or to whatever the manufacturer specifications require to ensure efficiently and longevity of the HVAC Units/s.

Recommendation

Recommended DIY Project



Back bedroom 1st Floor

10: INTERIORS

		IN	NI	NP	0
10.1	70) Walls, Ceilings, Floors	Χ			
10.2	71) Steps, Stairways	Χ			
10.3	72) Balconies, Railings	Χ		Χ	
10.4	73) Counters, Cabinetry	Χ			
10.5	74) Doors	Χ			
10.6	75) Windows	Χ			
10.7	76) Fire Seperation Walls and Ceilings	Χ			
10.8	77) Fire Seperation Doors	Χ			

IN = Inspected

NI = Not Inspected

NP = Not Present

O = Observations

Information

70) Walls, Ceilings, Floors: **Ceilings - Condition** Satisfactory


71) Steps, Stairways: Steps -Condition Satisfactory

70) Walls, Ceilings, Floors: Floors 70) Walls, Ceilings, Floors: Walls -

- Condition Satisfactory

71) Steps, Stairways: Stairways - 72) Balconies, Railings:



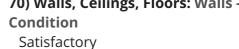

Balconies - Condition Not Present



72) Balconies, Railings: Railings - 73) Counters, Cabinetry: Condition Satisfactory

Cabinetry - Condition Satisfactory

73) Counters, Cabinetry: **Counters - Condition** Satisfactory



74) Doors: Condition Satisfactory

74) Doors: Operation **Operate Normally**

75) Windows: Condition Satisfactory with Exceptions Listed Below

75) Windows : OperationOperate (Minor Issues Listed Below)

76) Fire Seperation Walls and Ceilings : Ceiling ConditionSatisfactory



77) Fire Seperation Doors : Condition
Satisfactory



77) Fire Seperation Doors:

Operation

Operating Normally

76) Fire Seperation Walls and Ceilings : Walls - ConditionSatisfactory Where Visible





Observations

10.1.1 70) Walls, Ceilings, Floors

MOISTURE DAMAGE - WALL/S



At the time of the inspection, there was one or more section of interior walls that had water damage. Recommend identifying source of moisture, and all repairs/correction be made by licensed contractor.

Recommendation

Contact a qualified general contractor.







10.1.2 70) Walls, Ceilings, Floors

INTERIOR - GENERAL DAMAGE



The interior walls/ceilings had general damage consistent with the age of the home that can be considered cosmetic. Recommended corrections be made as desired by a general contractor.

Recommendation

Contact a qualified general contractor.

10.4.1 73) Counters, Cabinetry

Noteworthy Item/ DIY

CABINETS & COUNTERTOPS - GENERAL WEAR

At the time of the inspection one or more of the cabinets and countertops exhibited general wear consistent with the age of the home.

- If corrected/repaired, we recommend all repairs and corrections be done by a licensed cabinet contractor.

Recommendation

Contact a qualified cabinet contractor.

10.6.1 75) Windows

Recommendation

WINDOW/S - DOES NOT LATCH/LOCK

One or more of the windows in the residence is difficult to latch or does not lock. Recommend a full evaluation of all windows be made by licensed Window Contractor, and corrections be made as needed.

Recommendation

Contact a qualified window repair/installation contractor.













Master Bedroom



Dining Room

11: INSULATION, VENTILATION

		IN	NI	NP	0
11.1	78) Insulation	Χ			
11.2	79) Vapor Retarder	Χ			
11.3	80) Attic Ventilation	Χ			
11.4	81) Under Floor Crawl Space Ventilation	Χ		Χ	
11.5	82) Kitchen Ventilation	Χ			
11.6	83) Bathroom Ventilation	Χ			
11.7	84) Laundry Ventilation	Χ			

IN = Inspected

NI = Not Inspected

NP = Not Present

O = Observations

Information

78) Insulation : Type Blown, Cellulose

79) Vapor Retarder : Condition

Not Accessible

82) Kitchen Ventilation: Ventilation TypeVented



84) Laundry Ventilation: Ventilation TypePresent (Fan)



78) Insulation : Condition

Satisfactory

80) Attic Ventilation: Condition

Satisfactory

82) Kitchen Ventilation: Condition

Satisfactory

79) Vapor Retarder : Type

Unknown

81) Under Floor Crawl Space

Ventilation : Condition

Not Present

83) Bathroom Ventilation:

Condition

Satisfactory Where Visible

84) Laundry Ventilation: Condition

Satisfactory Where Visible

78) Insulation: R-value (Approximate)

30



80) Attic Ventilation: Ventilation TypeSoffit Vents, Ridge Vents



83) Bathroom Ventilation: Ventilation Type

Present (Fan)



STANDARDS OF PRACTICE

Built-in Appliances

10.1 The inspector shall inspect: F. installed ovens, ranges, surface cooking appliances, microwave ovens, dishwashing machines, and food waste grinders by using normal operating controls to activate the primary function. 10.2 The inspector is NOT required to inspect: G. installed and free-standing kitchen and laundry appliances not listed in Section 10.1.F. H. appliance thermostats including their calibration, adequacy of heating elements, self cleaning oven cycles, indicator lights, door seals, timers, clocks, timed features, and other specialized features of the appliance. I. operate, or con rm the operation of every control and feature of an inspected appliance.