



# MOUNTAINS TO SOUND HOME INSPECTION LLC

253.344.4714

[office@mshomeinspection.com](mailto:office@mshomeinspection.com)

<https://www.mshomeinspection.com/>



## HOME INSPECTION REPORT

27109 109th Ct SE  
Kent WA 98030

Araceli Manjarrez  
MARCH 19, 2020



Inspector

**Kelen Lewis**

Home Inspector Lic. 2211 SPI Lic. #97213

253.344.4714

[kelen@mshomeinspection.com](mailto:kelen@mshomeinspection.com)



Agent

**Diane Lucas**

Keller Williams Rty Bellevue

(206) 445-8143

[dianelucas@kw.com](mailto:dianelucas@kw.com)

## Table of Contents

Table of Contents	2
SUMMARY	4
1: POSITIVE ATTRIBUTES OF THE HOME	7
2: INSPECTION DETAILS	8
3: EXTERIOR	9
4: ROOF	17
5: GARAGE(S)	20
6: MAIN ELECTRICAL PANEL	23
7: HEATING SYSTEM	25
8: WATER HEATER & PLUMBING	27
9: KITCHEN	30
10: KITCHEN APPLIANCES	32
11: BATHROOMS	34
12: LAUNDRY	39
13: INTERIORS, WINDOWS & DOORS	41
14: ATTIC	52
15: CRAWLSPACE, FOUNDATION, STRUCTURE & BASEMENTS	55
16: GENERAL COMMENTS	56
17: REASONABLE EXPECTATIONS OF A HOME INSPECTION	59
18: REPORT CONCLUSION	61
STANDARDS OF PRACTICE	62

Thank you for choosing Mountains to Sound Home Inspection.

Please carefully read through the entire inspection report. We are happy to assist with additional question you may have.

This report is based on a visual inspection of the building at the time and date of the inspection. Given the limited time allowed for an inspection, please do not expect that every concern or issue will be noted. Conditions of an occupied home can change after an inspection or sellers items may obscure our view of other defects. We strongly recommend that you and/or your representative carry out a final walk through immediately before closing to check the condition of the property.

Listed with most items of concern is a recommendation for a trade specialist. For your safety and liability, these concerns should be evaluated by the appropriate contractors prior to closing. Further recommendations may be given by a specialist. Lastly, we recommend obtaining at a minimum a full 1 year warranty as additional items for repair are likely to come about within that time. Here is a video walk-through on [How to Read Your Inspection Report](#).

# SUMMARY



LOW PRIORITY



MEDIUM PRIORITY



HIGH PRIORITY

-  3.2.1 Exterior - Driveway, Walkways & Patio: Moderate Cracks in Driveway
-  3.2.2 Exterior - Driveway, Walkways & Patio: Cracks in walkways
-  3.5.1 Exterior - Exterior Siding Notes: Vegetation is encroaching
-  3.5.2 Exterior - Exterior Siding Notes: Touch-up Paint/Caulk
-  3.5.3 Exterior - Exterior Siding Notes: Damaged siding
-  3.5.4 Exterior - Exterior Siding Notes: Dryer vent debris
-  3.7.1 Exterior - Fascia, Trim & Eaves: Sections of fascia or wood trim are weathered
-  3.7.2 Exterior - Fascia, Trim & Eaves: Trim missing/damaged
-  3.8.1 Exterior - Exterior Plumbing: Hose bib leaks while in use
-  3.8.2 Exterior - Exterior Plumbing: Not secured to wall
-  3.8.3 Exterior - Exterior Plumbing: Hose bib missing handle
-  3.9.1 Exterior - Downspouts: Some downspouts are missing or need to be reconnected or serviced
-  3.10.1 Exterior - Exterior Doors: Sliding door screen missing/damaged
-  3.12.1 Exterior - Fences & Gates: Damaged fencing
-  3.15.1 Exterior - Deck: Decking Sagging
-  3.15.2 Exterior - Deck: Deck is deteriorated
-  3.15.3 Exterior - Deck: Rail damaged/deteriorated
-  3.15.4 Exterior - Deck: Weathered
-  3.15.5 Exterior - Deck: Deck Tiles Cracked
-  4.3.1 Roof - General Observations: Roof Safety Bracket Cover Missing
-  4.6.1 Roof - Skylights: Loose Skylight
-  5.2.1 Garage(s) - Automatic Opener: Garage door opener did not work on demand
-  5.3.1 Garage(s) - Garage Door & Hardware: Damage to garage door
-  5.3.2 Garage(s) - Garage Door & Hardware: Bad Seal
-  5.4.1 Garage(s) - Entry Door Into the House: Home entry not self closing
-  5.10.1 Garage(s) - Lights, Wall Switches: Ceiling light not working
-  5.11.1 Garage(s) - Outlets, Electrical Observations: Exposed wiring
-  5.11.2 Garage(s) - Outlets, Electrical Observations: Coverplate missing/Unsecured Outlet
-  6.5.1 Main Electrical Panel - Wiring Notes: Double Tap

- 7.2.1 Heating System - Furnace Notes: Service Furnace/HVAC System
- 7.8.1 Heating System - Registers: Air supply registers are dirty
- 8.1.1 Water Heater & Plumbing - Water Heating System: Seismic Straps - Missing/Insufficient
- 8.1.2 Water Heater & Plumbing - Water Heating System: Water temp too high
- 8.1.3 Water Heater & Plumbing - Water Heating System: Pipe from relief valve
- 8.1.4 Water Heater & Plumbing - Water Heating System: Added piping
- 9.1.1 Kitchen - Sink and Faucet: Hand Sprayer Does Not Work
- 9.2.1 Kitchen - Trap and Drain: leak at drain line below the sink
- 9.4.1 Kitchen - Countertop: Countertop damage
- 9.4.2 Kitchen - Countertop: Missing or Deteriorated Caulk/Grout
- 9.7.1 Kitchen - Doors: Door Missing
- 10.2.1 Kitchen Appliances - Dishwasher: Dishwasher did not work on demand
- 10.4.1 Kitchen Appliances - Range: Element not working
- 10.4.2 Kitchen Appliances - Range: Oven Did Not Work On Demand
- 11.1.1 Bathrooms - Sink and Faucet: Faucet drips
- 11.1.2 Bathrooms - Sink and Faucet: Sinks stopper needs work
- 11.1.3 Bathrooms - Sink and Faucet: Sink stopper(s) missing
- 11.1.4 Bathrooms - Sink and Faucet: Sink Damage
- 11.2.1 Bathrooms - Trap and Drain: Slow Drain
- 11.4.1 Bathrooms - Tub-Shower: Tub area cosmetic damage
- 11.4.2 Bathrooms - Tub-Shower: Caulking or sealing
- 11.5.1 Bathrooms - Toilet: Functional but loose
- 11.6.1 Bathrooms - Countertop: Countertop damage
- 11.6.2 Bathrooms - Countertop: Missing or Deteriorated Caulk/Grout
- 11.7.1 Bathrooms - Cabinets: Sink cabinet moisture damaged-lightly
- 11.10.1 Bathrooms - Flooring: Moisture has penetrated slab beneath finished floor
- 12.6.1 Laundry - Exhaust Fan: No exhaust fan or openable window
- 13.2.1 Interiors, Windows & Doors - Doors: Door striker plate
- 13.2.2 Interiors, Windows & Doors - Doors: Door damage
- 13.2.3 Interiors, Windows & Doors - Doors: Door hardware needs adjusting
- 13.3.1 Interiors, Windows & Doors - Flooring: Carpet is stained.
- 13.3.2 Interiors, Windows & Doors - Flooring: cracks in floor tiles or grout lines
- 13.3.3 Interiors, Windows & Doors - Flooring: Transition strips missing
- 13.3.4 Interiors, Windows & Doors - Flooring: Flooring Loose
- 13.4.1 Interiors, Windows & Doors - Walls and Ceiling: Normal wear and tear
- 13.4.2 Interiors, Windows & Doors - Walls and Ceiling: Typical settlement cracking/nail pops
- 13.4.3 Interiors, Windows & Doors - Walls and Ceiling: Evidence of moisture intrusion
- 13.4.4 Interiors, Windows & Doors - Walls and Ceiling: Wall/ceiling damaged
- 13.4.5 Interiors, Windows & Doors - Walls and Ceiling: Patch/past repair
- 13.5.1 Interiors, Windows & Doors - Windows: Broken seals
- 13.5.2 Interiors, Windows & Doors - Windows: A window lock is missing or does not engage

-  13.5.3 Interiors, Windows & Doors - Windows: Screens Damaged/Missing
-  13.7.1 Interiors, Windows & Doors - Smoke & CO Detectors Notes: Add carbon monoxide detector
-  13.7.2 Interiors, Windows & Doors - Smoke & CO Detectors Notes: Smoke detector is chirping
-  13.7.3 Interiors, Windows & Doors - Smoke & CO Detectors Notes: The smoke detectors missing
-  13.8.1 Interiors, Windows & Doors - Fireplace Notes: The damper is stuck
-  13.8.2 Interiors, Windows & Doors - Fireplace Notes: Doors/screen Missing
-  13.9.1 Interiors, Windows & Doors - Handrails & Guardrails: Handrail is loose
-  13.9.2 Interiors, Windows & Doors - Handrails & Guardrails: Damaged Guardrail
-  13.11.1 Interiors, Windows & Doors - Lights, Wall Switches: Light not working
-  13.11.2 Interiors, Windows & Doors - Lights, Wall Switches: Light damaged or missing components
-  13.11.3 Interiors, Windows & Doors - Lights, Wall Switches: Switch broken
-  13.12.1 Interiors, Windows & Doors - Outlets, Electrical: Missing covers
-  13.12.2 Interiors, Windows & Doors - Outlets, Electrical: Damaged Outlet
-  14.1.1 Attic - Method of Evaluation: Attic hatch missing
-  14.5.1 Attic - Insulation Notes: Displaced or removed insulation
-  14.6.1 Attic - Common Observations: Rodent Activity

# 1: POSITIVE ATTRIBUTES OF THE HOME

## Information

---

### Plumbing

The plumbing system was  
Copper plumbing

### Roof

Architectural Roof

### Addition Features

Wood Burning Fireplace

### Description

1993 built home with 5 bedrooms, 3.25 bathrooms, a master suite with walk in closet, an attached two car garage, wood burning fireplace, large deck from sliding glass doors, tile floors in the kitchen, and a fully fenced in backyard.

## 2: INSPECTION DETAILS

### Information

---

**Start Time**

9am

**In Attendance**

Inspector

**Occupancy**

Vacant

**Style**

Multi-level

**Weather Conditions**

Clear

**Year Built**

1993

**Temperature**

30-40 degrees

**Type of Building**

Single Family

**The images here are the directional locations of the home used throughout the report. Ensure you get yourself orientated to what direction the house is situated in order to better follow along.**



## 3: EXTERIOR

### Information

---

#### **Driveway, Walkways & Patio: Driveway Acceptable**

The driveway is in acceptable condition.

#### **Driveway, Walkways & Patio: Walkway Acceptable**

The walkways are in acceptable condition.

#### **Exterior Siding Notes: Siding Type**

Composition Wood Type  
Paneling, Cement Fiber Board

#### **Doorbell: Acceptable**

The doorbell is functional and works on demand.

#### **Fences & Gates: Acceptable**

The fences are were in acceptable condition.

#### **Fences & Gates: Gates in acceptable condition**

The gates were in acceptable condition.

#### **General Comments: Exterior comments**

It is important to maintain a property, including painting or sealing walkways, decks, and other hard surfaces, and it is particularly important to keep the house walls sealed, which provide the only barrier against deterioration. Unsealed cracks around windows, doors, and thresholds can permit moisture intrusion, which is the principle cause of the deterioration of any surface. Unfortunately, the evidence of such intrusion may only be obvious when it is raining. In the past, we have discovered leaking windows while it was raining that may not have been otherwise apparent. Regardless, there are many styles of windows but only two basic types, single and dual-glazed. Dual-glazed windows are superior, because they provide a thermal as well as an acoustical barrier. However, the hermetic seals on these windows can fail at any time, and cause condensation to form between the panes. Unfortunately, this is not always apparent, which is why we disclaim an evaluation of hermetic seals. Nevertheless, in accordance with industry standards, we test a representative number of unobstructed windows, and ensure that at least one window in every bedroom is operable and facilitates an emergency exit.

#### **Grading & Drainage: General Grading Comments**

Water can be destructive and foster conditions that are deleterious to health. For this reason, the ideal property will have soils that slope away from the residence and the interior floors will be several inches higher than the exterior grade. Also, the residence will have roof gutters and downspouts that discharge into area drains with catch basins that carry water away to hard surfaces. However, we cannot guarantee the condition of any subterranean drainage system, but if a property does not meet this ideal, or if any portion of the interior floor is below the exterior grade, we cannot endorse it and recommend that you consult with a grading and drainage contractor, even though there may not be any evidence of moisture intrusion. The sellers or occupants will obviously have a more intimate knowledge of the site than we could possibly hope to have during our limited visit, however we have confirmed moisture intrusion in residences when it was raining that would not have been apparent otherwise. Also, in conjunction with the cellulose material found in most modern homes, moisture can facilitate the growth of biological organisms that can compromise building materials and produce mold-like substances that can have an adverse affect on health.

#### **Grading & Drainage: Interior-Exterior Elevations**

There is an acceptable difference in elevation between the exterior grade and the interior floors that should ensure that moisture intrusion would not threaten the living space, but of course I cannot guarantee that.

#### **Exterior Siding Notes: Acceptable**

The exterior house wall finish is generally in acceptable condition. Any exceptions will be noted below.

#### **Foundation as Viewed from the Exterior: Exterior View**

The foundation was in acceptable condition as viewed from the exterior. Any exceptions will be noted.

#### **Fascia, Trim & Eaves: Acceptable**

The fascia boards, trim and eaves are in acceptable condition. Any exceptions will be noted below.

**Exterior Plumbing: Hose bibs Functional**

The hose bibs that were found and accessible were functional. Any exceptions will be noted.

**Downspouts: Acceptable**

The downspouts appear to be in acceptable condition. Any exceptions will be noted below. We recommend downspouts always drain away from the structure and foundation

**Exterior Doors: Exterior Doors Acceptable**

The exterior doors were in acceptable condition. Any exceptions will be noted.

**Exterior Doors: Front door Acceptable**

The front door is in acceptable condition with door sweep and weather stripping.

**Exterior Doors: Sliding glass door(s) is dual pane glass-Acceptable**

The sliding glass door is dual pane glass, tempered, operates smoothly and in acceptable condition.

**Lights: Acceptable**

The lights outside the doors of the residence are functional. Any sensor or light sensitive fixture lights were not tested.

## Limitations

Lights

**LIGHTS ON PHOTO SENSOR**

The lights were on a photocell sensor and not tested. You should ask the sellers about these to confirm their full function.

## Observations

3.2.1 Driveway, Walkways & Patio

**MODERATE CRACKS IN DRIVEWAY**

There are a few cracks in the driveway which is mostly cosmetic but you may want to view for yourself and repair as necessary.

Recommendation

Recommend monitoring.



3.2.2 Driveway, Walkways & Patio

**CRACKS IN WALKWAYS**

RIGHT SIDE

There are a few cracks in the walkways around the residence that are mostly cosmetic. We suggest you view these yourself and repair as necessary.

Recommendation

Contact a qualified professional.



3.5.1 Exterior Siding Notes

**VEGETATION IS ENCROACHING**

LEFT SIDE, RIGHT SIDE

Vegetation is encroaching on the structure, and should be kept a minimum of twelve inches away for the general welfare of the walls and foundation.

Recommendation

Contact a qualified landscaping contractor



3.5.2 Exterior Siding Notes

**TOUCH-UP PAINT/CAULK**

REAR

A few spots around the house should be painted and/or re-caulked.

Recommendation

Contact a qualified handyman.



3.5.3 Exterior Siding Notes

**DAMAGED SIDING**

REAR

Observed areas of damaged siding around the residence that should be repaired to help prevent moisture intrusion issues. These damaged areas can allow moisture to penetrate the walls if not properly repaired.



Recommendation  
Contact a qualified handyman.



3.5.4 Exterior Siding Notes

**DRYER VENT DEBRIS**

FRONT

The dryer vent is full of debris. We recommend cleaning to allow for proper venting of the dryer.

Recommendation  
Contact a qualified professional.

Medium Priority



3.7.1 Fascia, Trim & Eaves

**SECTIONS OF FASCIA OR WOOD TRIM ARE WEATHERED**

FRONT, REAR, CHIMNEY

Sections of the fascia board or wood trim around the residence are slightly weathered, and should be serviced as necessary to prevent further deterioration. Service such as scraping, repainting and sealing.

Recommendation  
Contact a qualified handyman.

Medium Priority



3.7.2 Fascia, Trim & Eaves

**TRIM MISSING/DAMAGED**

LEFT SIDE

A piece of trim is damaged or missing. Recommend repairs.

Recommendation

Contact a qualified professional.

Medium Priority



3.8.1 Exterior Plumbing

**HOSE BIB LEAKS WHILE IN USE**

REAR

The hose bib leaks at the handle while in use and you may want to have it repaired or replaced by a licensed professional. Sometimes they just need to be tightened.

[Click Here](#) go to fix yourself

Recommendation

Contact a qualified handyman.

Medium Priority



3.8.2 Exterior Plumbing

**NOT SECURED TO WALL**

FRONT

The hose bib is not secured to the wall. This could potentially damage the Plumbing. Recommend securing.

Recommendation

Contact a qualified professional.

Medium Priority



3.8.3 Exterior Plumbing

**HOSE BIB MISSING HANDLE**

FRONT

A hose bib is missing a handle, which should be replaced.

Recommendation

Contact a qualified handyman.

Medium Priority



## 3.9.1 Downspouts

**SOME DOWNSPOUTS ARE MISSING OR NEED TO BE RECONNECTED OR SERVICED** Medium Priority

FRONT, REAR

Some downspouts are missing parts or need to be reconnected or serviced.

Recommendation

Contact a qualified roofing professional.



## 3.10.1 Exterior Doors

**SLIDING DOOR SCREEN MISSING/DAMAGED** Medium Priority

The rear sliding screen is missing or needs work. Have it repaired by a qualified contractor.

Recommendation

Contact a qualified handyman.



## 3.12.1 Fences &amp; Gates

**DAMAGED FENCING** Low Priority

REAR

Observed some damaged fencing on the property that will need to either be repaired or replaced.



## 3.15.1 Deck

**DECKING SAGGING**

FRONT

There were spots where the decking was sagging possibly due to damaged support structure which should be evaluated and repaired.

 Medium Priority

## 3.15.2 Deck

**DECK IS DETERIORATED**

REAR

One or more sections of the deck are damaged or deteriorated. Further evaluation and repair is recommended

 Medium Priority

## 3.15.3 Deck

**RAIL DAMAGED/DETERIORATED**

FRONT

One or more sections of the deck guardrail or damaged or deteriorated. Recommend repair is needed.

 Medium Priority



3.15.4 Deck

**WEATHERED**

FRONT

Portions of the deck we're weathered and in need of minor repairs and maintenance.

 Medium Priority



3.15.5 Deck


**DECK TILES CRACKED**

Some of the tiles on the deck are cracked. Recommend repairs.

Recommendation

Contact a qualified professional.

 Medium Priority

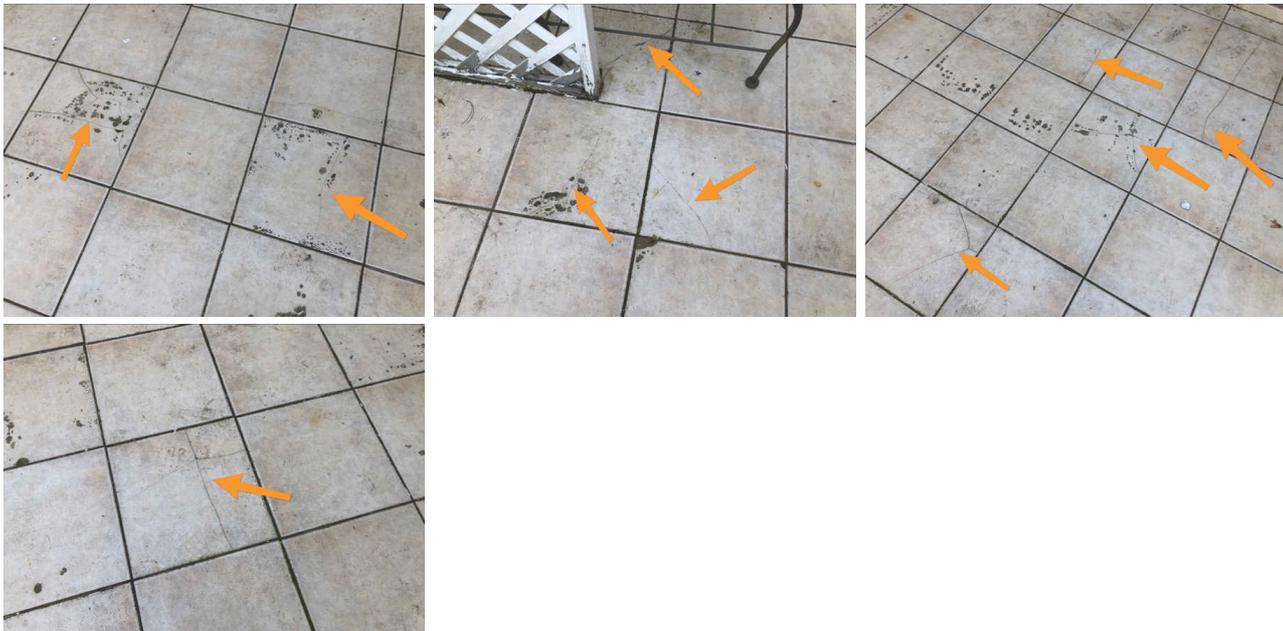

# 4: ROOF

## Information

**Chimney On Roof & Photo:**  
**Chimney Photo**



**Chimney On Roof & Photo: Rain**  
**Cap Acceptable**

The chimney has a functional weather cap/spark arrestor.

**Chimney On Roof & Photo:**  
**Chimney flashings Acceptable**

The chimney flashings are in acceptable condition.

**Method of Evaluation & Photos: Method of Evaluation & Photos**  
Walking on its surface



**Composition Shingle Roof Notes: Acceptable**

The roof is in generally acceptable condition. Any exceptions will be noted below. NOTE: This is not guarantee against leaks.

**Composition Shingle Roof Notes: Estimated Age**

3-5 Years Old

Because the exact installation date is unknown, this is an estimated guess of the age of the roof based on the current condition of the roof.

**Composition Shingle Roof Notes: General Comments and Description**

There are a wide variety of composition shingle roofs, which are comprised of asphalt or fiberglass materials impregnated with mineral granules that are designed to deflect the deteriorating ultra-violet rays of the sun. The commonest of these roofs are warranted by manufacturers to last from twenty to twenty-five years, and are typically guaranteed against leaks by the installer for three to five years. The actual life of the roof will vary, depending on a number of interrelated factors besides the quality of the material and the method of installation. However, the first indication of significant wear is apparent when the granules begin to separate and leave pockmarks or dark spots. This is referred to as primary decomposition, which means that the roof is in decline, and therefore susceptible to leakage. This typically begins with the hip and ridge shingles and to the field shingles on the south facing side. This does not mean that the roof needs to be replaced, but that it should be monitored more regularly and serviced when necessary. Regular maintenance will certainly extend the life of any roof, and will usually avert most leaks that only become evident after they have caused other damage.

**Vents & Flashings: Acceptable**

The roof flashings and vents are in acceptable condition where viewed. They appear to consist of metal flashing around roof penetrations and in valleys.

**Gutters & Drainage: Acceptable**

The gutters appear to be in acceptable condition. Any exceptions will be noted below.

**Skylights: Acceptable**

The roof includes skylight(s) that is in satisfactory condition. Any exceptions will be noted below. Skylights can be problematic and a common point of leaks. Therefore, it will be important to keep the area around them clean and to monitor them for evidence of leaks.

**Chimney On Roof & Photo: Acceptable**

The the chimney above the roof is in acceptable condition. Any exceptions will be noted.

**Chimney On Roof & Photo: The crown is in acceptable condition**

The crown, which is designed to seal the chimney wall and to shed rainwater and thereby prevent moisture from deteriorating the chimney, is in acceptable condition.

**Observations**

---

4.3.1 General Observations

Medium Priority

**ROOF SAFETY BRACKET COVER MISSING**

The roof super anchor safety bracket cover is missing and/or not installed, it's plastic protective cover and leakage is possible. We recommend that the safety anchor bracket cover be installed and secured in accordance with industry standards.

Recommendation

Contact a qualified professional.



4.6.1 Skylights

Medium Priority

**LOOSE SKYLIGHT**

The skylight is loose. We recommend securing.

Recommendation

Contact a qualified professional.



# 5: GARAGE(S)

## Information

### Picture and size of garage:

#### Picture and size of garage

Double Car Garage

The garage and its components were evaluated.



### Garage Door & Hardware:

#### Acceptable

The sectional garage door and its hardware are functional.

### Firewall Separation: Acceptable

The firewall separating the garage from the residence is functional.

### Walls and Ceiling: Acceptable

The visible walls and ceiling are in acceptable condition.

### Windows: Acceptable

The windows are functional.

### Lights, Wall Switches:

#### Acceptable

The ceiling lights are functional.

### Lights, Wall Switches:

#### Acceptable

The wall switches are functional.

### Outlets, Electrical Observations:

#### Acceptable

The outlets were in acceptable condition.

### Slab Floor: Acceptable

The visible garage slab floor is in acceptable condition. Small cracks are common and result as a consequence of the curing process, seismic activity, common settling, or the presence expansive soils, but are not structurally threatening.

### Parking Space: Check parking space to accommodate your vehicles

It would be prudent for you to see that the parking space is adequate to accommodate your vehicles.

## Observations

### 5.2.1 Automatic Opener

#### **GARAGE DOOR OPENER DID NOT WORK ON DEMAND**

 Medium Priority

The garage door will not close on demand when the wall button is pressed. Further evaluation and service as necessary from a qualified garage door technician is recommended.

Recommendation

Contact a qualified garage door contractor.



## 5.3.1 Garage Door &amp; Hardware

 Medium Priority
**DAMAGE TO GARAGE DOOR**

The garage door is damaged. Further evaluation and repair from a garage specialist is recommended.

Recommendation

Contact a qualified garage door contractor.



## 5.3.2 Garage Door &amp; Hardware

 Medium Priority
**BAD SEAL**

One or more garage door seals is bad and you may want to have it repaired to prevent moisture and rodent intrusion.

Recommendation

Contact a qualified handyman.



## 5.4.1 Entry Door Into the House

 Medium Priority
**HOME ENTRY NOT SELF CLOSING**

The house garage entry door is functional but does not self-close. This may not have been required when the house was built and you may elect to have self closing hinges installed for modern fire safety.

Recommendation

Contact a qualified handyman.



## 5.10.1 Lights, Wall Switches

 Low Priority
**CEILING LIGHT NOT WORKING**

Some lights around the residence did not have light bulbs or the bulbs were burnt out. Recommend replacing bulbs and testing.

Recommendation

Contact a qualified electrical contractor.



## 5.11.1 Outlets, Electrical Observations

 Medium Priority
**EXPOSED WIRING**

The exposed wiring should be covered in conduit for safety reasons. This is important to help prevent damaging the wiring and creating a shock hazard.

Recommendation

Contact a qualified electrical contractor.



5.11.2 Outlets, Electrical Observations

### **COVERPLATE MISSING/UNSECURED OUTLET**



Coverplates were missing on outlets, switches or junction boxes. Recommend installing cover plates and securing the outlets to a wall

Recommendation

Contact a qualified handyman.



## 6: MAIN ELECTRICAL PANEL

### Information

#### Service Entrance: Main Lines

Underground

#### Service Entrance: Main Lines


Acceptable

The electrical service entrances are acceptable.

#### Panel Size, Location & Photo:

Panel Amps, Location and Picture

Garage, 200 AMP

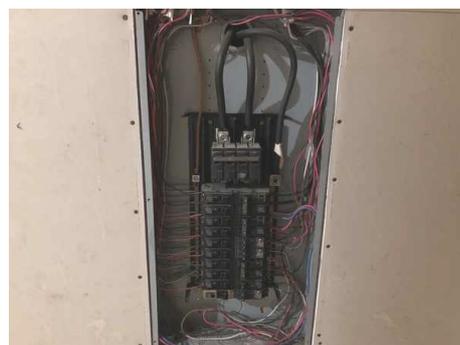

#### Panel Cover Condition:

Acceptable

The electrical panel cover is in acceptable condition.

#### Wiring Notes: Electrical Service

Conductors

Aluminum

#### Wiring Notes: Acceptable

The visible portions of the wiring have no deficiencies.

#### Circuit Breakers: Acceptable

There are no visible deficiencies with the circuit breakers.

#### Panel Size, Location & Photo: Earth Ground

Not visible

The main panel grounding was observed and found to be in good repair and of adequate function at the time of the inspection.

#### Main Panel Notes: Acceptable

The panel and its components have no visible deficiencies. Any exceptions will be noted below.

#### Wiring Notes: Romex wiring

Based on what is visible the residence appears to be wired predominantly with a modern vinyl conduit known as Romex.

### Observations

#### 6.5.1 Wiring Notes

##### DOUBLE TAP



There is at least one double tapped wires inside the breaker panel box. This should be further evaluated by a qualified electrician and Service as necessary.

Recommendation

Contact a qualified professional.



## 7: HEATING SYSTEM

### Information

#### General Notes & Photos: Energy Source/Type

Gas

#### Furnace Notes: Year

1992

#### Furnace Notes: Power Source/Type

Gas

#### Furnace Notes: Limit switches

The safety switches for the gas furnace were acceptable.

#### Vent Pipe: Acceptable

The gas furnace vent pipe is in acceptable condition.

#### Thermostats: Acceptable

The thermostats were functional at the time of the inspection.

#### Registers: Acceptable

The air supply registers are reasonably clean and appear functional.

#### General Notes & Photos: Equipment Photos



#### General Notes & Photos: Disclaimer

The components of most heating and air-conditioning systems have a design-life ranging from ten to twenty years, but can fail prematurely with poor maintenance, which is why we apprise you of their age whenever possible. We test and evaluate them in accordance with the standards of practice, which means that we do not dismantle and inspect the concealed portions of evaporator and condensing coils, the heat exchanger, which is also known as the firebox, electronic air-cleaners, humidifiers, ducts and in-line duct-motors or dampers. We perform a conscientious evaluation of both systems, but we are not specialists. However, even the most modern heating systems can produce carbon monoxide, which in a sealed or poorly ventilated room can result in sickness, debilitating injury, and even death. Therefore, in accordance with the terms of our contract, it is essential that any recommendations that we make for service or a second opinion be scheduled before the close of escrow, or within the inspection period if possible, because a specialist could reveal additional defects or recommend further upgrades that could affect your evaluation of the property, and our service does not include any form of warranty or guarantee. Having the heating and cooling system fully evaluated by a qualified HVAC technician before the close of escrow and at least annually is recommended, regardless of its condition.

#### Furnace Notes: Acceptable

The furnace was functional and responds when prompted at its thermostat. I recommend further review from a qualified HVAC technician for more information or a detailed evaluation, at least before the close of escrow, or as you feel necessary.

#### Furnace Notes: Thermocouple ok

The thermocouple is a gas furnace component located near the pilot light burner. It is a safety device that shuts off the gas if the pilot light goes out or the electric igniter fails. This was viewed on the furnace and appears acceptable. However only a specialist can determine its functionality.

**Age Related Notes: System 20 plus years old**

The hvac system is functional but likely near or beyond its design life. Therefore, it will need to be more closely monitored, they should be serviced annually, and have its filters changed every two to three months. However, it would also be wise to keep a home protection policy current.

**Gas Valve & Connector: Acceptable**

The gas valve and connector are in acceptable, visible condition, however the valve itself was not turned or operated.

**Combustion-Air Vents: Acceptable**

The combustion-air vents appear to be adequate to support complete combustion.

**Ducting: Acceptable**

The easily visible ducts have no visible deficiencies. Any exceptions will be noted.

**Return-Air Compartment: Acceptable**

The return-air compartments are in acceptable condition. I recommend changing the filters every 30 - 60 days or as required by the manufacturer. Any interior or internal HVAC system filters were not evaluated as part of this inspection. This includes any filters located within the interior air handler or furnace unit where located in the attic, garage or a closet etc.

## Observations

---

## 7.2.1 Furnace Notes

**SERVICE FURNACE/HVAC SYSTEM**

The last know service date of the HVAC system was over one year ago or a service record was not found on or around the HVAC system. Recommend a heating & cooling contractor thoroughly clean and inspect all HVAC equipment. Servicing would be appropriate prior to closing.

## Recommendation

Contact a qualified heating and cooling contractor


## 7.8.1 Registers

**AIR SUPPLY REGISTERS ARE DIRTY**

The air supply registers are dirty and you may consider having the ductwork professionally cleaned. As a reminder, we do not test the air quality.

## Recommendation

Contact a qualified HVAC professional.

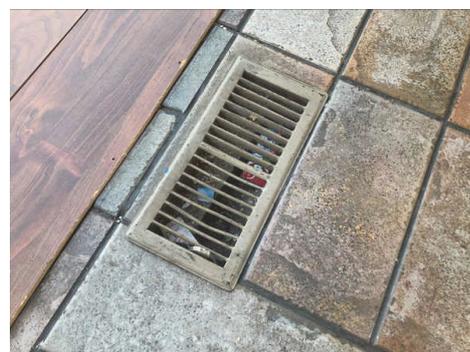

## 8: WATER HEATER & PLUMBING

### Information

**Water Heating System: Energy Source/Type**

Gas

**Water Heating System: Year**

2012

**Water Heating System: Location**

Garage

**Water Heating System: Capacity**

50

**Water Heating System: Drain Valve-Acceptable**

The drain valve is in place and presumed to be functional.

**Water Heating System: Middle Age**

The water heater is in the middle years of its expected service life.

**Main Water Shut-Off, Distribution & Supply: Main Water Shut off Location**

Not found

**Main Water Shut-Off, Distribution & Supply: Water Meter Location**

Front

**Main Water Shut-Off, Distribution & Supply: Water Supply Material To House**

Unknown

**Drain, Waste, & Vent Systems: Waste pipe Material**

ABS

**Gas Components: Main Gas Shut-off Location**

Meter

**Water Heating System: Manufacturer and picture**

GE


I recommend flushing & servicing your water heater tank annually for optimal performance. Water temperature should be set to at least 120 degrees F to kill microbes and no higher than 130 degrees F to prevent scalding.

[Here is a nice maintenance guide from Lowe's to help.](#)



**Water Heating System: Water Shut-Off Valve & Connectors**

The shut-off valve and water connectors appear functional, but was not tested.

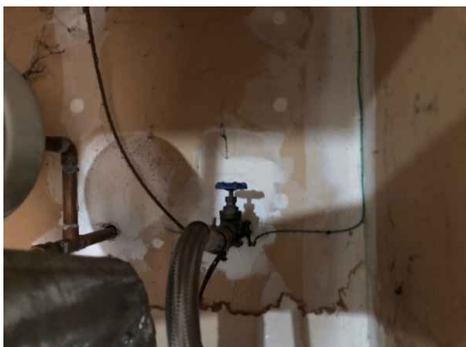

**Water Heating System: Thermal Expansion Tank**

This water heater includes a safety feature known as a thermal expansion tank or potable water expansion tank that appears acceptable.

**Water Heating System: Has Drain Pan & Discharge Pipe**

The water heater is equipped with a drain pan and discharge pipe, which is designed to prevent water damage from a leak. Nevertheless, the water heater should be periodically monitored for any signs of a leak.

**Water Heating System: Gas Shut-Off Valve & Connector**

The gas control valve and its connector at the water heater were not moved but appear functional.

**Water Heating System: Vent Flue-Acceptable**

The vent/flue was in good repair and was mechanically fastened and met proper clearances at the time of the inspection.

**Main Water Shut-Off, Distribution & Supply: Plumbing acceptable**

The plumbing was generally in acceptable condition. Any exceptions will be noted low.

**Main Water Shut-Off, Distribution & Supply: Water Distribution Material**

Copper

A representative amount of the plumbing distribution system was observed and found to be in good repair.

**Drain, Waste, & Vent Systems: Acceptable**

Based on industry recommended water tests, the drainpipes are functional and acceptable at this time and functional drainage was noted. However, only a video-scan of the main drainpipe could confirm its actual condition which is beyond the scope of a general home inspection. Any exceptions will be noted below.

**Drain, Waste, & Vent Systems: Side Sewer Notes**

For a full evaluation of the waste line, we recommend that a sewer scope be completed.

**Gas Components: Gas Supply Pipes-Acceptable**

The visible portions of the gas pipes and their supports appear to be in acceptable condition.

**Observations**

## 8.1.1 Water Heating System

**SEISMIC STRAPS - MISSING/INSUFFICIENT**

The hot water heater was missing seismic straps or was insufficiently anchored. Recommend two straps to properly secure water heater in the case of an earthquake.

Recommendation

Contact a qualified professional.

 High Priority



## 8.1.2 Water Heating System

**WATER TEMP TOO HIGH**

The water temperature is too high and is a potential hazard. Recommend water temperature be lowed not to exceed 120 degrees.

 High Priority

Recommendation  
Recommended DIY Project



8.1.3 Water Heating System

Medium Priority

### PIPE FROM RELIEF VALVE

The discharge pipe from the pressure relief valve is recommended to be plumbed to the exterior and terminate no more than twenty-four inches above grade and closer than six inches to it.

Recommendation

Contact a qualified plumbing contractor.



8.1.4 Water Heating System

Medium Priority

### ADDED PIPING

Recommend removing the added piping from the water heater.

Recommendation

Contact a qualified professional.



## 9: KITCHEN

### Information

#### Sink and Faucet: Acceptable

The kitchen sink and faucet are functional.

#### Trap and Drain: Acceptable

The kitchen trap and drain are functional. No leaking was noted.

#### Countertop: Acceptable

The visible areas of the kitchen countertops were functional.

#### Exhaust Fan Notes: Acceptable

Vents to Exterior

The kitchen exhaust fan was functional.

#### Walls and Ceiling: Acceptable

The walls and ceiling are textured drywall and in acceptable condition.

#### Cabinets: Acceptable

The cabinets are functional, and do not have any significant damage.

#### Outlets, Electrical Observations: Acceptable

The outlets functioned as intended.

#### Lights, Wall Switches: Acceptable

The wall switches are functional.

#### Lights, Wall Switches: Acceptable

The ceiling lights are functional.

#### Kitchen-PICTURE



#### Valves and Connectors: Acceptable

The kitchen valves and connectors below the sink appear functional. Valves were not turned, however no leaking was noted at the time of inspection. Valves are not in daily use and will inevitably become stiff or frozen.

### Observations

#### 9.1.1 Sink and Faucet

#### HAND SPRAYER DOES NOT WORK

The hand sprayer at the kitchen sink does not work. Recommend replacing.

Recommendation

Contact a qualified professional.

 Medium Priority



## 9.2.1 Trap and Drain

**LEAK AT DRAIN LINE BELOW THE SINK** High Priority

There is a leak at the drain line below the sink which should be repaired as necessary.

Recommendation

Contact a qualified professional.



## 9.4.1 Countertop

**COUNTERTOP DAMAGE** Low Priority

The kitchen countertop has some damage on it and you may want to have it repaired or replaced.

Recommendation

Contact a qualified general contractor.



## 9.4.2 Countertop

**MISSING OR DETERIORATED CAULK/GROUT** Low Priority

The caulking or grout for the backsplash is missing, has gaps and/or not installed properly. We advise caulking/grout be installed and/or gaps filled to prevent possible water intrusion.

Recommendation

Recommended DIY Project



## 9.7.1 Doors

**DOOR MISSING** Low Priority

The pantry door is missing. Recommend installing one.

Recommendation

Contact a qualified professional.



# 10: KITCHEN APPLIANCES

## Information

### Range: Acceptable

The range is functional.

### Range: Range type

Electric range

### Garbage Disposal: Acceptable

Garbage disposal was functional and ran quietly at the time of the inspection.

## Limitations

Refrigerator

### UNPLUGGED

The refrigerator was not inspected for function due to it being unplugged.



## Observations

10.2.1 Dishwasher

### DISHWASHER DID NOT WORK ON DEMAND

Dishwasher was inoperable using standard controls. Recommend a qualified plumber or contractor evaluate.

Recommendation

Contact a qualified professional.

Medium Priority



10.4.1 Range

### ELEMENT NOT WORKING

BASEMENT KITCHEN

One of the elements on the electric range does not respond, and should be replaced.

Recommendation

Contact a qualified appliance repair professional.

Medium Priority



10.4.2 Range

**OVEN DID NOT WORK ON DEMAND**

Medium Priority

The kitchen oven did not work on demand. Recommend repairs or replacement.

Recommendation

Contact a qualified professional.



# 11: BATHROOMS

## Information

### Sink and Faucet: Acceptable

The sinks were functional.

### Trap and Drain: Acceptable

The trap and drain are functional. No leaking was noted.

### Toilet: Acceptable

The toilets were functional, flushes properly and no leaking noted.

### Countertop: Acceptable

The countertops were functional.

### Cabinets: Acceptable

The cabinets are functional, and do not have any significant damage.

### Exhaust Fan: Acceptable

The bathroom exhaust fan is functional and works on demand.

### Doors: Acceptable

The door(s) are functional.

### Walls and Ceiling: Acceptable

The walls and ceiling are textured drywall and in acceptable condition.

### Windows: Acceptable

The windows are functional.

### Lights, Wall Switches: Acceptable

The wall switches are functional.

### Lights, Wall Switches: Acceptable

The ceiling/wall lights are functional.

### Outlets, Electrical Observations: Serviceable

All tested Outlets were serviceable. Any exceptions will be noted.

### HVAC: Acceptable

Heating was acceptable.

### Bathroom Photos

These photos are to show the condition of the bathrooms at the time of the inspection.



## Bathrooms In Acceptable Condition

The bathrooms are overall in acceptable and serviceable condition. Any exceptions will be noted in their perspective areas.

### Valves and Connectors: Acceptable

The valves and connectors below the sink appear functional. Valves were not turned, however no leaking was noted at the time of inspection. Valves are not in daily use and will inevitably become stiff or frozen.

### Tub-Shower: Acceptable

The tub/shower is functional. Hot and cold water supply temperature was verified and no leaking noted.

### Flooring: Acceptable

The floor is in satisfactory condition and has no significant visible defects.

## Observations

### 11.1.1 Sink and Faucet



#### FAUCET DRIPS

MASTER BATHROOM

The faucet drips or runs continuously and should be repaired or replaced as necessary.

Recommendation

Contact a qualified handyman.



### 11.1.2 Sink and Faucet



#### SINKS STOPPER NEEDS WORK

2ND FLOOR HALLWAY BATHROOM

The sinkstopper does not work properly and repair is recommended.

Recommendation

Contact a qualified handyman.



### 11.1.3 Sink and Faucet



#### SINK STOPPER(S) MISSING

BASEMENT BATHROOM

Sink stoppers should be installed if desired.

Recommendation

Contact a qualified handyman.



11.1.4 Sink and Faucet

**SINK DAMAGE**

MASTER BATHROOM

The sink has some cosmetic damage. Recommend repairs/replacement if desired.

Recommendation

Contact a qualified professional.

 Low Priority



11.2.1 Trap and Drain

**SLOW DRAIN**

MASTER BATHROOM

The sink drains too slowly, and should be serviced by a handyman.

Recommendation

Contact a qualified handyman.

 Medium Priority



11.4.1 Tub-Shower

**TUB AREA COSMETIC DAMAGE**

BASEMENT BATHROOM

The tub area has some cosmetic damage that you should view for yourself and repair as necessary.

Recommendation

Contact a qualified handyman.

 Low Priority



## 11.4.2 Tub-Shower

 Low Priority
**CAULKING OR SEALING**

BASEMENT BATHROOM

I recommend caulking or sealing around shower valves and faucets etc to help prevent moisture intrusion behind or into the walls.

Monitoring these areas is also recommended to help ensure an adequate seal is in place.

Recommendation

Contact a qualified handyman.



## 11.5.1 Toilet

 Medium Priority
**FUNCTIONAL BUT LOOSE**

1ST FLOOR BATHROOM, MASTER BATHROOM

The toilet is functional, but loose on the floor and should be secured by a qualified technician, for safety reasons and to prevent possible damage or leaking from around the toilet.

Recommendation

Contact a qualified plumbing contractor.



## 11.6.1 Countertop

 Low Priority
**COUNTERTOP DAMAGE**

2ND FLOOR HALLWAY BATHROOM

The countertop has some damage on it and you may want to have it repaired or replaced.

Recommendation

Contact a qualified general contractor.



## 11.6.2 Countertop

 Low Priority
**MISSING OR DETERIORATED CAULK/GROUT**

MASTER BATHROOM

The caulking or grout for the backsplash is missing, has gaps and/or not installed properly. We advise caulking/grout be installed and/or gaps filled to prevent possible water intrusion.

Recommendation

Recommended DIY Project



#### 11.7.1 Cabinets

### **SINK CABINET MOISTURE DAMAGED-LIGHTLY**

 Low Priority

The floor of the sink cabinet is functional but slightly moisture stained. I recommend you should view this and correct as desired.

Recommendation

Recommend monitoring.



#### 11.10.1 Flooring

### **MOISTURE HAS PENETRATED SLAB BENEATH FINISHED FLOOR**

 Medium Priority

2ND FLOOR HALLWAY BATHROOM

Moisture has penetrated beneath the finished floor and onto the subfloor. We can elaborate on this condition, but it should be evaluated by a specialist and repaired.

Recommendation

Contact a qualified professional.



# 12: LAUNDRY

## Information

### Washer & Dryer: Equipment photos



### Washer & Dryer: Dryer power source

220 Electric

### Washer & Dryer: No washer and dryer

Basement

There was not a washer or dryer at the time of the inspection



### Cabinets and Shelves:

**Acceptable**

The shelves are satisfactory

### Outlets, Electrical Observations:

**Serviceable**

### Washer & Dryer: Washer acceptable

At the time of inspection the washer was working. It was ran momentarily on one cycle and appeared to be working correctly. This is a limited washer inspection and you should ask the seller about all the appliances and ask about any issues.

### Washer & Dryer: Dryer acceptable

The dryer was briefly tested and produced heat and appeared to be working on at least one cycle. Efficiency or capability was not tested. This is a limited Dryer inspection and you should ask the seller about all the appliances.

### Dryer Vent: Acceptable

The visible dryer vent connection appears correct. NOTE: Faulty dryer vents have been responsible for thousands of fires, hundreds of injuries, and even deaths. The best vents are a smooth-walled metal type that travels a short distance; all other types should be regarded as suspect, and should be inspected bi-annually to ensure that they do not contain trapped lint or moisture.

### 220 Volt Receptacle: 220 In-Use

The 220 volt receptacle for the dryer is in use. Power supply was not tested at the outlet. I recommend you should evaluate this outlet style to be sure the dryer you plan on using here is compatible with it.

### Trap & Drain: Acceptable

The washing machine drain line appears satisfactory but is not visible because it's behind or within the wall.

### Valves & Connectors: Acceptable

The washing machine valves and connectors appear functional but were not tested. No leaking was noted. However, because they are not in daily use they typically become stiff or frozen.

## Observations

## 12.6.1 Exhaust Fan

**NO EXHAUST FAN OR OPENABLE WINDOW**

There is not a laundry exhaust fan or openable window installed within this laundry room. Adding one is recommended and typically required to help disperse excessive moisture from the laundry room.

# 13: INTERIORS, WINDOWS & DOORS

## Information

---

### General Notes: Home needs a thorough cleaning

The home is in need of a deep clean.

### Windows: Acceptable

The windows are functional.

### Fireplace Notes: Type of fireplace & Photo

Wood Burning



### Outlets, Electrical: Acceptable

The outlets were functional and grounded. Exceptions will be noted.

### Doors: Acceptable

The door(s) are functional.

### Closet: Acceptable

The door(s) are functional.

### Lights, Wall Switches: Acceptable

The wall switches are functional.

### Walls and Ceiling: Acceptable

The walls and ceiling are textured drywall and in acceptable condition.

### Closet: Acceptable

The closet was inspected and appeared to be in acceptable condition

### Lights, Wall Switches: Acceptable

The ceiling lights are functional.

### Outlets, Electrical: Light switches acceptable

The light switches were functional during the inspection.

### Miscellaneous Topics Installed: See Not Inspected Tab

**General Notes: Interior Photos**

These photos are to show the condition of the interiors at the day of the inspection.



**General Notes: Bedrooms Photos**

These photos are to show the condition of the bedrooms at the time of the inspection.



**General Notes: Interiors in Acceptable condition**

Windows, doors, floor and fixtures were overall in acceptable and serviceable condition. This also includes wall, ceilings and and other surfaces. Any exceptions will be noted in their perspective areas.

**General Notes: This property is vacant**

This property is vacant. The inspector is unable to determine the period of time this house has been unoccupied. Major systems were reviewed during the home inspection. Plumbing related fixtures, appliances and piping systems were reviewed for appropriate function and leaks, as applicable, at visible areas. However, due to non-use of plumbing and other major systems for a period of time it is important that these systems be reviewed during your final walk-through prior to closing and closely monitored for a few months after occupancy for evidence of leaks and other problems. We also suggest monitoring visible areas of sub-flooring, under showers, toilets and tubs for wet conditions during this same period.

**Flooring: Acceptable**

The floor is in satisfactory condition and has no significant visible defects.

**Smoke & CO Detectors Notes: Smoke & carbon Monoxide present**

Unless noted there was at least the minimally required amount of smoke and CO detectors in the living areas. Our recommendation is that smoke detectors be installed in each bedroom, outside of sleeping areas, and at least one on each floor. Carbon monoxide detectors should be on each floor. It is recommended they should be checked periodically for fire safety and replaced as necessary.

**Handrails & Guardrails: Acceptable**

The handrail or guardrail on the stairs is satisfactory and in good condition.

**Floor Treads & Risers: Acceptable**

The stair treads and risers appear satisfactory. The rise should not be less than 4 inches, nor greater than 7 inches, and the treads should not be less than 11 inches. In addition, the dimensions of the treads and the risers should not exceed 3/8 of an inch from the smallest dimension on the entire run of the stairs.

**GFCI Notes: GFCI OK**

GFCI (Ground Fault Circuit Interrupter) protection was installed for all of the receptacles where this type of protection was required at the time of the dwellings construction. All suggested locations include garages, bathrooms, kitchens, laundry rooms, and all other locations with plumbing fixtures. We recommend testing these devices on a monthly basis.

**GFCI Notes: GFCI Overview**

GFCI (ground fault circuit interrupter) protection is a modern safety device designed to help prevent shock hazards. GFCI breakers and receptacle's function is to de-energize a circuit or a portion of a circuit when a hazardous condition exists. GFCI protection is inexpensive and can provide a substantial increased margin of safety.

Present requirement standards include receptacles near sink and wash basins. In Bathrooms, Kitchen, Garages, Exterior, Crawl Spaces and sump pump equipment.

## Limitations

---

Miscellaneous Topics Installed

**ALARM SYSTEM**

There was a alarm system installed. Testing of the alarm is beyond the scope of a home inspection. We recommend gathering information on all of the control locations, features and operation of the system.

## Observations

---

13.2.1 Doors

**DOOR STRIKER PLATE**


BASEMENT BATHROOM



The door striker plate needs to be adjusted or installed for the striker pin to engage.

Recommendation

Contact a qualified handyman.

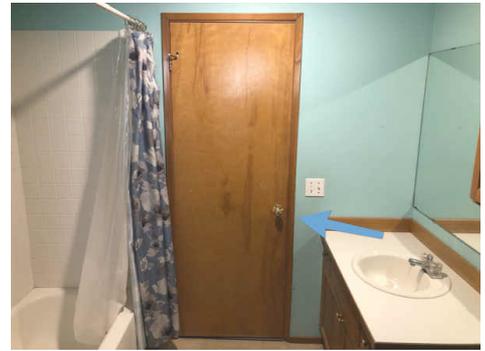

13.2.2 Doors

**DOOR DAMAGE**


BASEMENT BATHROOM

The door has damage that you may want repaired

Recommendation

Contact a qualified handyman.

 Low Priority

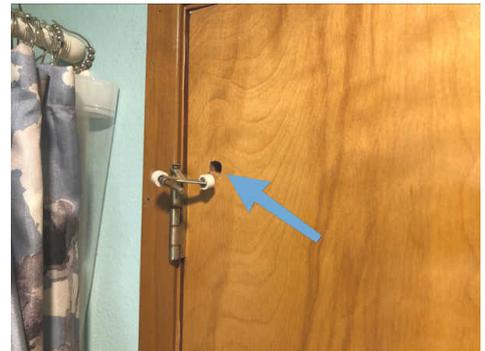

13.2.3 Doors

**DOOR HARDWARE NEEDS ADJUSTING**

FRONT RIGHT SIDE BEDROOM

One more doors have Hardware that is missing or in need repair or adjustment.

Recommendation

Contact a qualified professional.

 Low Priority



13.3.1 Flooring

**CARPET IS STAINED.**


MULTIPLE AREAS

The carpet is stained. Recommend a thorough cleaning or replacement as needed.

Recommendation

Contact a qualified professional.

 Low Priority

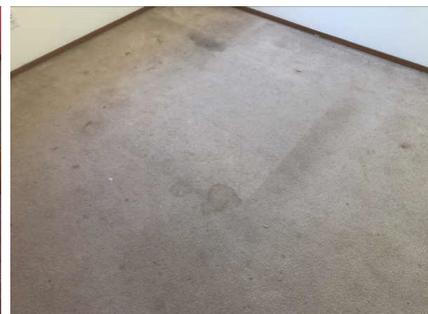



## 13.3.2 Flooring

**CRACKS IN FLOOR TILES OR GROUT LINES**

KITCHEN

There are cracks in the floor tiles or grout lines, which you should view for yourself. They are likely to have been caused by normal settlement, but you may wish to seek the opinion of a specialist; especially if you are concerned or desire more information. Recommend repairs.

Recommendation

Contact a qualified flooring contractor

 Medium Priority


## 13.3.3 Flooring


**TRANSITION STRIPS MISSING**

SUN ROOM

Transition strips were missing or damaged between one surface to another. Recommend installing as needed.

Recommendation

Contact a qualified professional.

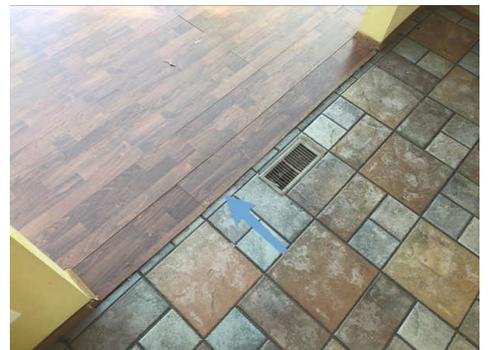 Low Priority


## 13.3.4 Flooring

**FLOORING LOOSE**

SUN ROOM

Some of the flooring was loose. Recommend repairs.

Recommendation

Contact a qualified professional.

 Medium Priority


## 13.4.1 Walls and Ceiling

**NORMAL WEAR AND TEAR**
 Low Priority

The walls or ceiling have minor cosmetic damage (scuffs, scrapes, nail holes etc) that you should view yourself and correct as desired.

Recommendation

Recommended DIY Project

13.4.2 Walls and Ceiling

 Low Priority

**TYPICAL SETTLEMENT CRACKING/NAIL POPS**

FAMILY ROOM

Observed typical settlement type cracking and nail pops on walls and ceilings. Recommend repairs as needed. Home owner to identify all areas for repair.

Recommendation

Recommend monitoring.



13.4.3 Walls and Ceiling

 Medium Priority

**EVIDENCE OF MOISTURE INTRUSION**

SUN ROOM, BASEMENT CLOSET

There is evidence of moisture intrusion on the on the wall/ceiling. Recommend having the condition further evaluated and repaired by a licensed contractor.

Recommendation

Contact a qualified general contractor.



13.4.4 Walls and Ceiling

 Low Priority


**WALL/CEILING DAMAGED**

2ND FLOOR HALLWAY, BEDROOMS

The wall/ceiling has some damage and repair is recommended.

Recommendation

Contact a qualified drywall contractor.

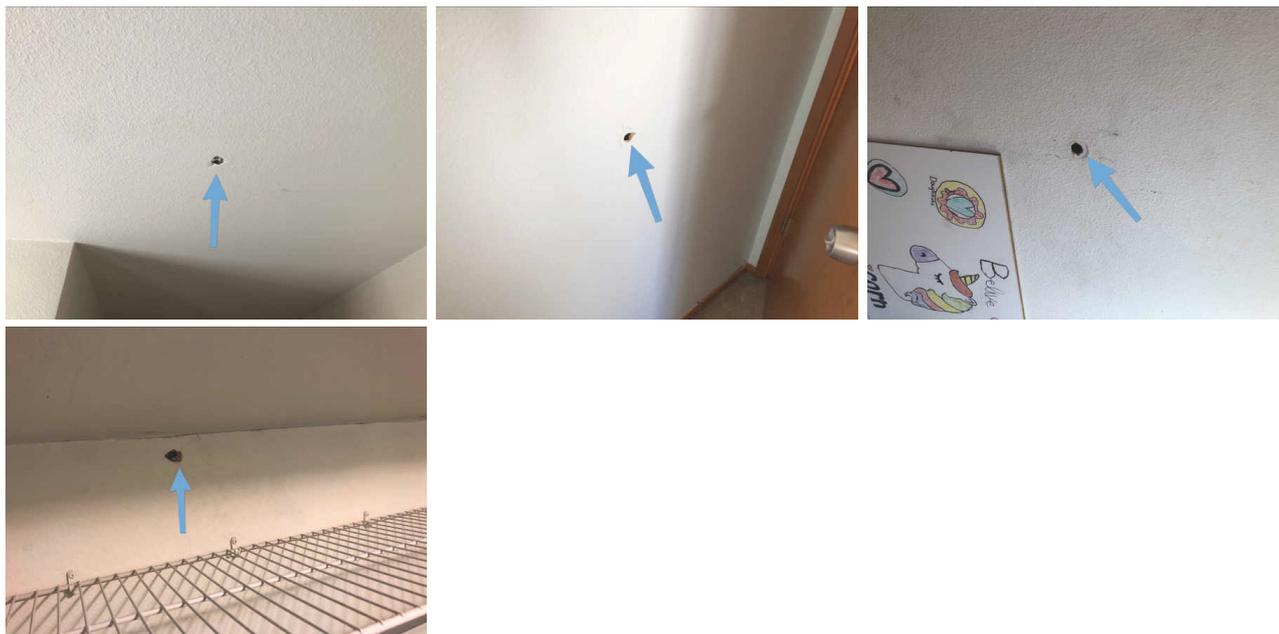

13.4.5 Walls and Ceiling

**PATCH/PAST REPAIR**

LIVING ROOM, HALLWAY, BASEMENT BATHROOM

 Low Priority

Patches or repairs were observed in the wall or ceiling. We could not determine the reason for the repairs. Recommend monitoring.

Recommendation

Contact a qualified professional.



13.5.1 Windows

**BROKEN SEALS**

FRONT LEFT SIDE BEDROOM, REAR BASEMENT BEDROOM

 Medium Priority

A window(s) has broken hermetic seals, and should be replaced. This is evident from fogging, or condensation forming between the panes of glass, that confirm that the seal has failed. If you are concerned we recommend that you have a professional check out all the windows within the residence.

Recommendation

Contact a qualified window repair/installation contractor.



13.5.2 Windows

Medium Priority

**A WINDOW LOCK IS MISSING OR DOES NOT ENGAGE**

FRONT LEFT SIDE BEDROOM

A window lock is missing or does not engage, and should be serviced.

Recommendation

Contact a qualified window repair/installation contractor.



13.5.3 Windows

Low Priority

**SCREENS DAMAGED/MISSING**

THROUGHOUT THE HOME

Window screens were missing or damaged in one or more areas. We recommend repair or replacement as needed.

Recommendation

Contact a qualified professional.



13.7.1 Smoke & CO Detectors Notes

High Priority

**ADD CARBON MONOXIDE DETECTOR**

In order to ensure that your home has maximum protection, it's important to have a **CO detector** on every floor. **Carbon monoxide detectors** can get the best reading of your home's air when they are **placed per manufacturer's instructions**.

Recommendation

Contact a qualified handyman.

## 13.7.2 Smoke &amp; CO Detectors Notes

**SMOKE DETECTOR IS CHIRPING**

1ST FLOOR, 2ND FLOOR

The smoke detector is chirping, and should be serviced.

Recommendation

Contact a qualified handyman.

 Medium Priority


## 13.7.3 Smoke &amp; CO Detectors Notes

**THE SMOKE DETECTORS MISSING**

FRONT LEFT SIDE BEDROOM

The smoke detector is missing and should be installed as a fire safety feature.

Recommendation

Contact a qualified handyman.

 Medium Priority


## 13.8.1 Fireplace Notes

**THE DAMPER IS STUCK**

The damper is stuck, either by rust or thermal warping, and should be evaluated and serviced or replaced as necessary by a qualified technician.

Recommendation

Contact a qualified chimney contractor.

 Medium Priority


## 13.8.2 Fireplace Notes

**DOORS/SCREEN MISSING**

There was a missing door at the fireplace. We recommend the door be installed.

Recommendation

Contact a qualified professional.

 Medium Priority


## 13.9.1 Handrails &amp; Guardrails


 Medium Priority
**HANDRAIL IS LOOSE**

The handrail is loose and should be properly secured by a qualified contractor for safety reasons.



## 13.9.2 Handrails &amp; Guardrails


 Medium Priority
**DAMAGED GUARDRAIL**

2ND FLOOR

The guardrail at the top of the stairs was damaged. Recommend repairs.

Recommendation

Contact a qualified professional.



## 13.11.1 Lights, Wall Switches


 Low Priority
**LIGHT NOT WORKING**

KITCHEN, STAIRWAY, 2ND FLOOR BATHROOM

A light fixture did not have light bulbs or the bulbs were burnt out. Recommend replacing bulbs and testing.

Recommendation

Contact a qualified handyman.



## 13.11.2 Lights, Wall Switches


 Low Priority
**LIGHT DAMAGED OR MISSING COMPONENTS**

BASEMENT

The light was damaged or missing components. Recommend repair as needed.

Recommendation

Contact a qualified professional.



13.11.3 Lights, Wall Switches

**SWITCH BROKEN**

SUN ROOM

A wall switch is broken and should be replaced

Recommendation

Contact a qualified electrical contractor.



13.12.1 Outlets, Electrical

**MISSING COVERS**

LIVING ROOM

There were missing covers that should be installed

Recommendation

Contact a qualified handyman.



13.12.2 Outlets, Electrical

**DAMAGED OUTLET**

2ND FLOOR HALLWAY

A damaged Outlet was observed. Recommend replacement.

Recommendation

Contact a qualified professional.



# 14: ATTIC

## Information

### Attic Access Location

Multiple Locations

### Insulation Notes: Acceptable

Insulation is acceptable

### Insulation Notes: Insulation

Type

Mineral Wool


### Exhaust Ducts: Acceptable

The visible portions of the exhaust ducts appear to be functional.

### Plumbing Vents: Acceptable

The accessible plumbing vents were in acceptable condition.

### Attic Photos

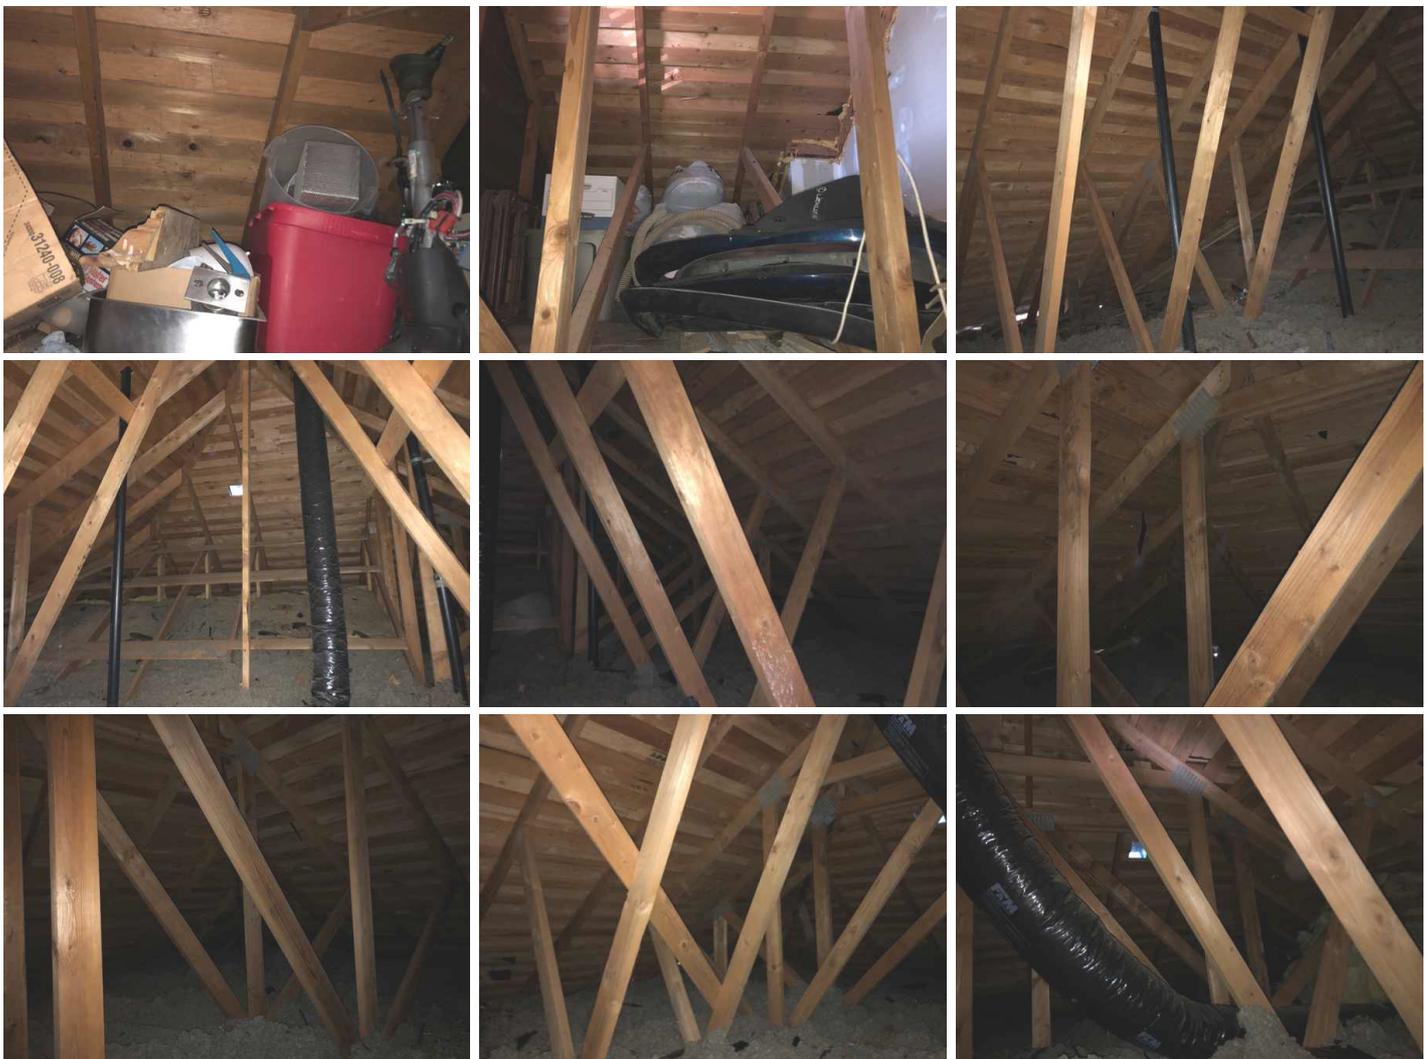

### General Info

In accordance with our standards, we do not attempt to enter attics that have less than thirty-six inches of headroom, are restricted by ducts, or in which the insulation obscures the joists and thereby makes mobility hazardous, in which case we would inspect them as best we can from the access point. In regard to evaluating the type and amount of insulation on the attic floor, we use only generic terms and approximate measurements, and do not sample or test the material for specific identification. Also, we do not disturb or move any portion of it, and it may well and often does obscure water pipes, electrical conduits, junction boxes, exhaust fans, heating and cooling ducts and other components.

**Method of Evaluation: From Hatch Only**

The attic was evaluated from the access due to inadequate clearance or risk of damage to insulation and other components.

**Framing Notes: Factory-built truss system - Acceptable**

The roof framing is in satisfactory condition. The roof framing consists of a factory- built wood truss system, comprised of components called chords, webs, and struts that are connected by metal gussets nailed in place. Each component of the truss is designed for a specific purpose, and cannot be removed or modified without compromising the integrity of the entire truss. The lowest component, which is called the chord and to which the ceiling is attached, can move by thermal expansion and contraction and cause creaking sounds, which are more pronounced in the mornings and evenings along with temperature changes. Such movement has no structural significance, but can result in small cracks or divots in the drywall or plaster.

**Roof Decking Notes: Plywood decking-Acceptable**

The visible portions of the plywood roof decking are in acceptable condition and should conform to the standards of the year in which they were installed.

**Roof Decking Notes: Wood board or plank-Acceptable**

The visible portions of the wood board or plank roof decking are in acceptable condition and should conform to the standards of the year in which they were installed.

**Electrical Notes: Attic electrical-Acceptable**

The attic electrical components that are easily visible and not covered by insulation appear to be in acceptable condition.

**Ventilation: Plumbing Vents-Acceptable**

The drainpipe vents that are fully visible appear to be in acceptable condition.

**Ventilation: Ventilation - Acceptable**

Ventilation is provided by a combination soffit, gable or roof vents and should be adequate. However, contacting a qualified insulation contractor about having your attic ventilation upgraded could help lower energy costs by cooling down your attic during the warmer summer months.

## Observations

---

14.1.1 Method of Evaluation

**ATTIC HATCH MISSING**

GARAGE

The attic hatch was missing. Recommend installing



Medium Priority



14.5.1 Insulation Notes

**DISPLACED OR REMOVED INSULATION**

There is an area of displaced or removed insulation, that should be replaced to conserve energy and prevent heating and cooling loss.



Medium Priority



#### 14.6.1 Common Observations

### RODENT ACTIVITY

The attic has evidence of rodent activity. We recommend ceiling access points in eliminating any active rodent activity

Medium Priority



# 15: CRAWLSPACE, FOUNDATION, STRUCTURE & BASEMENTS

## Information

---

### Foundation: Inspection Method

From Exterior Only

### Foundation: Material/Type

Concrete

The foundation showed only the normal signs of weathering and or cracking at the time of the inspection.

### Foundation: Foundation Acceptable

The foundation was found to be in acceptable condition. Any exceptions will be noted below.

## Limitations

---

Sump pump

### APPEARED SERVICEABLE

The sump pump controls were not accessible but appeared to be serviceable.



# 16: GENERAL COMMENTS

## Information

---

### General Info

This report is the exclusive property of Mountains to Sound Home Inspection, LLC and the client whose name appears herewith, and its use by any unauthorized persons is strictly prohibited.

The observations and opinions expressed in this report are those of Mountains to Sound Home Inspection, LLC and supersede any alleged verbal comments. I inspect all of the systems, components, and conditions described in accordance with the standards of the Washington State Home Inspector Standards of Practice and those that I do not inspect are clearly disclaimed in the contract and/or in the aforementioned standards. However, some components that are inspected and found to be functional may not necessarily appear in the report, simply because we do not wish to waste our client's time by having them read an unnecessarily lengthy report about components that do not need to be serviced.

In accordance with the terms of the contract, the service recommendations that I make in this report should be completed well before the close of escrow by licensed specialists, who may well identify additional defects or recommend some upgrades that could affect your evaluation of the property.

This report has been produced in accordance with our signed contract and is subject to the terms and conditions agreed upon therein. All printed comments and the opinions expressed herein are those of the Inspection Company.

### Scope of work

You have contracted with Mountains to Sound Home Inspection, LLC to perform a generalist inspection in accordance with the standards of practice established by the state of Washington and the International Association of Certified Home Inspectors (InterNACHI), a copy of which is available upon request. Generalist inspections are essentially visual, and distinct from those of specialists, inasmuch as they do not include the use of specialized instruments, the dismantling of equipment, or the sampling of air and inert materials. Consequently, a generalist inspection and the subsequent report will not be as comprehensive, nor as technically exhaustive, as that generated by specialists, and it is not intended to be. The purpose of a generalist inspection is to identify significant defects or adverse conditions that would warrant a specialist evaluation. Therefore, you should be aware of the limitations of this type of inspection, which is clearly indicated in the standards. However, the inspection is not intended to document the type of cosmetic deficiencies that would be apparent to the average person, and certainly not intended to identify insignificant deficiencies. Similarly, we do not inspect for vermin infestation, which is the responsibility of a licensed exterminator.

Most homes built after 1978, are generally assumed to be free of asbestos and many other common environmental contaminants. However, as a courtesy to our clients, we are including some well documented, and therefore public, information about several environmental contaminants that could be of concern to you and your family, all of which we do not have the expertise or the authority to evaluate, such as asbestos, radon, methane, formaldehyde, termites and other wood-destroying organisms, pests and rodents, molds, microbes, bacterial organisms, and electromagnetic radiation, to name some of the more commonplace ones. Nevertheless, we will attempt to alert you to any suspicious substances that would warrant evaluation by a specialist. However, health and safety, and environmental hygiene are deeply personal responsibilities, and you should make sure that you are familiar with any contaminant that could affect your home environment. You can learn more about contaminants that can affect your home from a booklet published by The Environmental Protection Agency, which you can read online at [www.epa.gov/iaq/pubs/insidest.htm](http://www.epa.gov/iaq/pubs/insidest.htm).

MOLD is one such contaminant. It is a microorganism that has tiny seeds, or spores, that are spread in the air then land and feed on organic matter. It has been in existence throughout human history and actually contributes to the life process. It takes many different forms, many of them benign, like mildew. Some characterized as allergens are relatively benign but can provoke allergic reactions among sensitive people, and others characterized as pathogens can have adverse health effects on large segments of the population, such as the very young, the elderly, and people with suppressed immune systems. However, there are less common molds that are called toxins that represent a serious health threat. All molds flourish in the presence of moisture, and we make a concerted effort to look for any evidence of it wherever there could be a water source, including that from condensation. Interestingly, the molds that commonly appear on ceramic tiles in bathrooms do not usually constitute a health threat, but they should be removed. However, some visibly similar molds that form on cellulose materials, such as on drywall, plaster, and wood, are potentially toxigenic. If mold is to be found anywhere within a home, it will likely be in the area of tubs, showers, toilets, sinks, water heaters, evaporator coils, inside attics with unvented bathroom exhaust fans, and return-air compartments that draw outside air, all of which are areas that we inspect very conscientiously. Nevertheless, mold can appear as though spontaneously

at any time, so you should be prepared to monitor your home, and particularly those areas that we identified. Naturally, it is equally important to maintain clean air-supply ducts and to change filters as soon as they become soiled because contaminated ducts are a common breeding ground for dust mites, rust, and other contaminants. Regardless, although some mold-like substances may be visually identified, the specific identification of molds can only be determined by specialists and laboratory analysis and is absolutely beyond the scope of our inspection. Nonetheless, as a prudent investment in environmental hygiene, we categorically recommend that you have your home tested for the presence of any such contaminants, and particularly if you or any member of your family suffers from allergies or asthma. Also, you can learn more about mold from an Environmental Protection Agency document entitled "A Brief Guide to Mold, Moisture, and Your Home," by visiting their website at: <http://www.epa.gov/iaq/molds/moldguide.html/>, from which it can be downloaded.

ASBESTOS is a notorious contaminant that could be present in any home built before 1978. It is a naturally occurring mineral fiber that was first used by the Greek and Romans in the first century, and it has been widely used throughout the modern world in a variety of thermal insulators, including those in the form of paper wraps, bats, blocks, and blankets. However, it can also be found in a wide variety of other products too numerous to mention, including duct insulation and acoustical materials, plasters, siding, floor tiles, heat vents, and roofing products. Although perhaps recognized as being present in some documented forms, asbestos can only be specifically identified by laboratory analysis. The most common asbestos fiber that exists in residential products is chrysotile, which belongs to the serpentine or white-asbestos group, and was used in the clutches and brake shoes of automobiles for many years. However, a single asbestos fiber is said to be able to cause cancer and is, therefore, a potential health threat and a litigious issue. Significantly, asbestos fibers are only dangerous when they are released into the air and inhaled, and for this reason authorities such as the Environmental Protection Agency [EPA] and the Consumer Product Safety Commission [CPSC] distinguish between asbestos that is in good condition, or non-friable, and that which is in poor condition, or friable, which means that its fibers could be easily crumbled and become airborne. However, we are not specialists and, regardless of the condition of any real or suspected asbestos-containing material [ACM], we would not endorse it and recommend having it evaluated by a specialist.

POPCORN CEILING- In early formulations, it often contained white asbestos fibers. When asbestos was banned in ceiling treatments by the Clean Air Act of 1978 in the United States,[1] popcorn ceilings fell out of favor in much of the country. However, in order to minimize economic hardship to suppliers and installers, existing inventories of asbestos-bearing texturing materials were exempt from the ban, so it is possible to find asbestos in popcorn ceilings that were applied through the 1980s. According to the EPA, the use of asbestos in textured ceiling paint was banned in 1977. Inhaled in large quantities, asbestos fibers can cause lung disease, scarring of the lungs and lung cancer. However, not all popcorn ceilings contain asbestos. Moreover, if left undisturbed or contained, asbestos is not dangerous.

RADON is a gas that results from the natural decay of radioactive materials in the soil and is purported to be the second leading cause of lung cancer in the United States. The gas is able to enter homes through the voids around pipes in concrete floors or through the floorboards of poorly ventilated crawlspaces, and particularly when the ground is wet and the gas cannot easily escape through the soil and be dispersed into the atmosphere. However, it cannot be detected by the senses, and its existence can only be determined by sophisticated instruments and laboratory analysis, which is completely beyond the scope of our service. However, you can learn more about radon and other environmental contaminants and their effects on health, by contacting the Environmental Protection Agency (EPA), at [www.epa.gov/radon/images/hmbuygud.pdf](http://www.epa.gov/radon/images/hmbuygud.pdf), and it would be prudent for you to inquire about any high radon readings that might be prevalent in the general area surrounding your home.

LEAD poses an equally serious health threat. In the 1920's, it was commonly found in many plumbing systems. In fact, the word "plumbing" is derived from the Latin word "plumbum," which means lead. When in use as a component of a waste system, it is not an immediate health threat, but as a component of potable water pipes, it is a definite health hazard. Although rarely found in modern use, the lead could be present in any home build as recently as the nineteen forties. For instance, lead was an active ingredient in many household paints, which can be released in the process of sanding, and even be ingested by small children and animals chewing on painted surfaces. Fortunately, the lead in painted surfaces can be detected by industrial hygienists using sophisticated instruments, but testing for it is not cheap. There are other environmental contaminants, some of which we have already mentioned, and others that may be relatively benign. However, we are not environmental hygienists, and as we stated earlier we disclaim any responsibility for testing or establishing the presence of any environmental contaminant, and recommend that you schedule whatever specialist inspections that may deem prudent within the contingency period.

CRACKS AND WINDOWS Unsealed cracks around windows, doors, and thresholds can permit moisture intrusion, which is the principal cause of the deterioration of any surface. Unfortunately, the evidence of such intrusion may only be obvious when it is raining. We have discovered leaking windows while it was raining that may not have been apparent otherwise. Regardless, there are many styles of windows but only two basic types, single and dual-

glazed. Dual-glazed windows are superior because they provide a thermal as well as an acoustical barrier. However, the hermetic seals on these windows can fail at any time, and cause condensation to form between the panes. Many environmental factors come into play when and if hermetic seals have failed and Unfortunately, it is not always apparent, which is why we disclaim an evaluation of hermetic seals or unnoticed fogging glass. Nevertheless, in accordance with industry standards, we test a representative number of unobstructed windows and ensure that at least one window in every bedroom is operable and facilitates an emergency exit.

FURTHERMORE, you are advised to seek two professional opinions and acquire estimates of repair as to any defects, comments, improvements or recommendations mentioned in this report. We recommend that the professional making any repairs inspect the property further in order to discover and repair related problems that were not identified in the report. We recommend that all repairs, corrections, and cost estimates be completed and documented prior to closing or purchasing the property. Feel free to hire other professionals to inspect the property prior to closing. Including HVAC professionals, electricians, engineers, window professionals roofers etc.

All conditions are reported as they existed at the time of the inspection. The information contained in this report may be unreliable beyond the date of the inspection due to changing conditions.

# 17: REASONABLE EXPECTATIONS OF A HOME INSPECTION

## Information

---

### Setting Reasonable Expectations

Setting Reasonable Expectations When Things Go Wrong.

There may come a time that you discover something wrong with the house, and you may be upset or disappointed with your home inspection.

### Intermittent Or Concealed Problems

Some problems can only be discovered by living in a house. They cannot be discovered during the few hours of a home inspection. For example, some shower stalls leak when people are in the shower, but do not leak when you simply turn on the tap. Some roofs and basements only leak when specific conditions exist. Some problems will only be discovered when carpets were lifted, furniture is moved or finishes are removed.

### No Clues

These problems may have existed at the time of the inspection but there were no clues as to their existence. Our inspections are based on the past performance of the house. If there are no clues of a past problem, it is unfair to assume we should foresee a future problem.

### We Always Miss Some Minor Things

Some say we are inconsistent because our reports identify some minor problems but not others. The minor problems that are identified were discovered while looking for more significant problems. We note them simply as a courtesy. The intent of the inspection is not to find the \$200 problems; it is to find the \$2,000 problems. These are the things that affect peoples decisions to purchase.

### Contractors Advice

The main source of dissatisfaction with home inspectors comes from comments made by contractors. Contractors opinions often differ from ours. Dont be surprised when three roofers all say the roof needs replacement when we said that, with some minor repairs, the roof will last a few more years.

### Last Man In Theory

While our advice represents the most prudent thing to do, many contractors are reluctant to undertake these repairs. This is because of the Last Man In Theory. The contractor fears that if he is the last person to work on the roof, he will get blamed if the roof leaks, regardless of whether the roof leak is his fault or not. Consequently, he wont want to do a minor repair with high liability when he could re-roof the entire house for more money and reduce the likelihood of a callback. This is understandable.

### Most Recent Advice Is Best

There is more to the Last Man In Theory. It suggests that it is human nature for homeowners to believe the last bit of expert advice they receive, even if it is contrary to previous advice. As home inspectors, we unfortunately find ourselves in the position of First Man In and consequently it is our advice that is often disbelieved.

### Why Didnt We See It

Contractors may say I cant believe you had this house inspected, and they didnt find this problem. There are several reasons for these apparent oversights:

#### 1. Conditions During Inspection

It is difficult for homeowners to remember the circumstances in the house, at the time of the inspection. Homeowners seldom remember that it was snowing, there was storage everywhere in the basement or that the

furnace could not be turned on because the air conditioning was operating, et cetera. Its impossible for contractors to know what the circumstances were when the inspection was performed.

## **2. The Wisdom Of Hindsight**

When the problem manifests itself, it is very easy to have 20/20 hindsight. Anybody can say that the basement is wet when there is 2 inches of water on the floor. Predicting the problem is a different story.

## **3. A Long Look**

If we spent 1/2 an hour under the kitchen sink or 45 minutes disassembling the furnace, wed find more problems too. Unfortunately, the inspection would take several days and would cost considerably more.

## **4. Were Generalists**

We are generalists; we are not specialists. The heating contractor may indeed have more heating expertise than we do.

## **5. An Invasive Look**

Problems often become apparent when carpets or plaster are removed, when fixtures or cabinets are pulled out, and so on. A home inspection is a visual examination. We dont perform any invasive or destructive tests.

## **Not Insurance**

In conclusion, a home inspection is designed to better your odds. It is not designed to eliminate all risk. For that reason, a home inspection should not be considered an insurance policy. The premium that an insurance company would have to charge for a policy with no deductible, no limit and an indefinite policy period would be considerably more than the fee we charge. It would also not include the value added by the inspection.

We hope this is food for thought.

# 18: REPORT CONCLUSION

## Information

---

### Conclusion

Congratulations on the purchase of your new home. Since we never know who will be occupying or visiting a property, whether it be children or the elderly, we ask you to consider following these general safety recommendations: install and monitor smoke and carbon monoxide detectors; identify all escape and rescue ports; rehearse an emergency evacuation of the home; upgrade older electrical systems (if present) by at least adding ground-fault outlets; never service any electrical equipment without first disconnecting its power source; safety-film all non-tempered glass; ensure that every elevated window and the railings of stairs, landings, balconies, and decks are child-safe, meaning that barriers are in place or that the distance between the rails is not wider than three inches; regulate the temperature of water heaters to prevent scalding; make sure that goods that contain caustic or poisonous compounds, such as bleach, drain cleaners, and nail polish removers be stored where small children cannot reach them; ensure that all garage doors are well balanced and have a safety device, particularly if they are the heavy wooden type; remove any double-cylinder deadbolts from exterior doors; and consider installing child-safe locks and alarms on the exterior doors of all pool and spa properties.

We are proud of our service and trust that you will be completely satisfied with the quality of our report. We have made every effort to provide you with an accurate assessment of the condition of the property and its components and to alert you to any significant defects or adverse conditions. However, we may not have tested every outlet, and opened every window and door, or identified every minor defect. Also because we are not specialists or because our inspection is essentially visual, latent defects could exist. Therefore, you should not regard our inspection as conferring a guarantee or warranty. It does not. It is simply a report on the general condition of a particular property at a given point in time. Furthermore, as a homeowner, you should expect problems to occur. Roofs will leak, drain lines will become blocked, and components and systems will fail without warning. For these reasons, you should take into consideration the age of the house and its components and keep a comprehensive insurance policy current. If you have been provided with a home protection policy, read it carefully. Such policies usually only cover insignificant costs, such as that of roofer service, and the representatives of some insurance companies can be expected to deny coverage on the grounds that a given condition was preexisting or not covered because of what they claim to be a code violation or manufacturers defect. Therefore, you should read such policies very carefully, and depend upon our company for any consultation that you may need.

FURTHERMORE, you are advised to seek two professional opinions and acquire estimates of repair as to any defects, comments, improvements or recommendations mentioned in this report. We recommend that the professional making any repairs inspect the property further in order to discover and repair related problems that were not identified in the report. We recommend that all repairs, corrections, and cost estimates be completed and documented prior to closing or purchasing the property. Feel free to hire other professionals to inspect the property prior to closing. Including HVAC professionals, electricians, engineers, window professionals roofers etc.

Thank you for taking the time to read this report, and call us if you have any questions or observations whatsoever. I am always attempting to improve the quality of my service and this report, and I will continue to adhere to the highest standards of the real estate industry and to treat everyone with kindness, courtesy, and respect.

---

# STANDARDS OF PRACTICE

---

## Exterior

This inspection is not intended to address or include any geological conditions or site stability information. For information concerning these conditions a geologist or soils engineer should be consulted. Any reference to grade is limited to only areas around the exterior of the exposed foundation or exterior walls. This inspection is visual in nature and does not attempt to determine drainage performance of the site or the condition of any underground piping, including municipal water and sewer service piping or septic systems.

When decks and porches are built close to the ground where no viewing or access is possible, we cannot make accurate opinions. These areas as well as others that are too low to enter, or in some other manner not accessible, are excluded from the inspection and are not addressed in this report. We routinely recommend that inquiry be made with the seller about knowledge of conditions, repairs are usually noted in the form seventeen.

Our inspection of the Exterior grounds includes the surface drainage, grading, some fencing, gates, sidewalks, patios, driveways, and retaining walls adjacent to the structure. The inspection of the exterior of the building includes the cladding, trim, eaves, fascias, decks, porches, downspouts, railings, doors, windows and flashings. Areas hidden from view by finished walls or stored items can not be judged and are not a part of this inspection. Minor cracks are typical in many foundations and most do not represent a structural problem. If major cracks are present along with rotation, we routinely recommend further evaluation be made by a qualified professional structural engineer. All exterior grades should allow for surface and roof water to flow away from the foundation. All concrete slabs experience some degree of cracking due to shrinkage in the drying process or minor settlement.

Where deck carpeting, stacked firewood, excessive vegetation, soil and other coverings are installed, the materials or their nature of construction and condition of the underneath cannot be determined. All items listed are inspected for their proper function, poor installation, excessive wear and general state of repair.

## Roof

The inspection of the roof system includes a visual examination of the surface materials, connections, penetrations and roof drainage systems. We examine the roofing material for damage and deterioration. We examine the roof system for possible leaks, damage and conditions that suggest limited remaining service life. We may offer opinions concerning repair and/or replacement if warranted. Opinions stated herein concerning the roofing material are based on the general condition of the roof system as evidence by our visual inspection.

These do not constitute a warranty that the roof is or will remain, free of leaks. All roofing systems require annual maintenance. Failure to perform routine maintenance will usually result in leaks and accelerated deterioration of the roof covering and flashings. When provided, our estimates of the roof's life expectancy are based on the assumption that the roof will be properly maintained during that period.

This report is issued in consideration a foregoing disclaimer in the future. The only way to determine whether a roof is absolutely water tight is to observe it during a prolonged rainfall. Many times, this situation is not present during the inspection and we cannot confirm this condition. We suggest that a annual inspection of the Attic area be performed where accessible to identify if any leaks are evident.

## Garage(s)

The Garage is inspected as best as possible, but can be limited due to parked cars or personal stored items. Due to this area be cluttered or areas being inaccessible, it is common for sections that cannot not be fully inspected or items identified during our limited inspection. We suggest that a walk-through be performed once the home is vacant. If this is a new construction inspection or vacant home this area will be inspected thoroughly. Determining the heat resistance rating of fire walls and doors is beyond the scope of this inspection. Flammable materials should not be stored within the Garage area if possible.

## Main Electrical Panel

Our examination of the electrical system includes a visual examination of the exposed and accessible branch circuits, wiring, service panel, over current protection devices, lighting fixtures, switches, and receptacles. Service equipment, proper grounding, wiring methods and bonding are focal points. We inspect for adverse conditions such as improper installation of aluminum wiring, lack of grounding and bonding, over-fusing, exposed wiring, open-air wire splices, reverse polarity and defective GFCI's. The hidden nature of the electrical wiring prevents inspection of every length of wire or their connections. Telephone, video, cable, audio, security systems and other low voltage systems were not included in this inspection unless specifically noted. We recommend you have the seller or a specialist demonstrate the serviceability or locations of these systems to you if necessary.

Any electrical repairs attempted by anyone other than a licensed electrician should be approached with caution. The power to the entire house should be turned off prior to beginning any repair efforts, no matter how trivial the repair may seem. Aluminum wiring requires periodic inspection and maintenance by a licensed electrician. Operation of time clock motors is not verified. Inoperative light fixtures often lack bulbs or have dead bulbs installed. Light bulbs are not changed during the inspection, due to time constraints. Smoke Alarms should be installed within 15 feet of all Bedroom doors and in Bedrooms. These units should be tested monthly.

### **Heating System**

Our examination of the heating system includes a visual examination of the exposed and accessible heating equipment, thermostat, safety controls, venting and the means of air distribution. Our inspection of the heating system includes activating the heating system via the thermostat and a visual examination of the accessible components listed below.

These items are examined for proper function, excessive or unusual wear and general state of repair. Heat exchangers are inaccessible by design, and are not part of the Washington standards of practice. They must be completely removed from the furnace to be fully evaluated. Our inspection does not include disassembly of the furnace. The inspector cannot light pilot lights due to the liability. Safety devices are not tested by the inspector. To obtain maximum efficiency and reliability from your heating system, we recommend annual servicing and inspections by a qualified heating specialist.

Determining the condition of oil tanks, whether exposed or buried, is beyond the scope of this inspection. Leaking oil tanks represent an environmental hazard which is sometimes a costly condition to address.

### **Water Heater & Plumbing**

Our inspection of the water heater includes a visual examination of the accessible portions of the tank, gas, electrical and/or water connections, venting and safety valves. These items are examined for proper function, excessive or unusual wear, leakage and general state of repair.

Our Inspection of the plumbing system includes a visual examination of the exposed portions of the domestic water supply, drain waste, vent, gas lines, faucets, fixtures, valves, drains, traps, exposed pipes and fittings. These items are examined for proper function, excessive or unusual wear, leakage and general state of repair. The hidden nature of piping prevents inspection of every pipe and joint connection, especially in walls, floors and ceiling voids. A sewer lateral test is necessary to determine the condition of the underground sewer lines is beyond the scope of this inspection.

Our review of the plumbing system does not include landscape irrigation systems, water wells, on site and/or private water supply systems, off site community water supply systems, or private (septic) waste disposal systems unless specifically noted. Review of these systems could be performed by qualified specialists prior to closing of escrow.

### **Kitchen**

Inspection of the stand alone refrigerators, freezers and built-in ice makers are outside the scope of the inspection. No opinion is offered as to the adequacy of dishwasher operation. Ovens, self or continuous cleaning operations, cooking functions, clocks, timing devices, lights and thermostat accuracy are not tested during this inspection. Appliances are not moved during the inspection to inspect below or behind them. Portable dishwashers are not inspected, as they require connection to facilitate testing and are sometimes not left with the home.

### **Bathrooms**

Our inspection of the bathrooms included a visual examination of the readily accessible portions of the floors, walls, ceilings, cabinets, countertops and plumbing fixtures. Bathrooms are inspected for water drainage, damage, deterioration to floor and walls, proper function of components, active leakage, unusual wear and general state of repair. Bathroom fixtures are run simultaneously to check for adequate water flow and pressure. Fixtures are tested using normal operating controls. Vent fans and their duct work are tested for their proper operation and examined where visible.

Shower pans are visually checked for leakage, but leaks often do not show except when the shower is in actual use. Determining whether shower pans, tub/shower surrounds are water tight is beyond the scope of this inspection. It is very important to maintain all grouting and caulking in the bath areas. Very minor imperfections can allow water to get into the wall or floor areas and cause damage. Proper ongoing maintenance will be required in the future.

### **Interiors, Windows & Doors**

Our inspection of the Interior includes a visual inspection of the readily accessible portions of the walls, ceilings, floors, doors, cabinetry, countertops, steps, stairways, balconies and railings. Please note that a representative sample of the accessible windows and electrical receptacles are inspected. These features are examined for proper function, excessive wear and general state of repair. In some cases, all or portions of these components may not be

visible because of furnishings and personal items. In these cases some of the items may not be inspected.

The condition of walls behind wall coverings, paneling and furnishings cannot be judged. Only the general condition of visible portions of floors is included in this inspection. As a general rule, cosmetic deficiencies are considered normal wear and tear and are not reported. Determining the source of odors or like conditions is not a part of this inspection. Floor covering damage or stains may be hidden by furniture. The condition of floors underlying floor coverings is not inspected. Determining the condition of insulated glass windows is not always possible due to temperature, weather and lighting conditions. Check with owners for further information. All fireplaces should be cleaned and inspected on a regular basis to make sure that no cracks have developed. Large fires in the firebox can overheat the firebox and flue liners, sometimes resulting in internal damage.

### **Attic**

Our inspection of the Attic includes a visual examination of the roof framing, plumbing, electrical and mechanical systems. There are often heating ducts, bathroom vent ducts, electrical wiring, chimneys and appliance vents in the Attic. We examined these systems and components for proper function, unusual wear and general state of repair, leakage, venting and unusual or improper improvements. When low clearances and deep insulation prohibits walking in an unfinished Attic, inspection will be from the access opening only. Vaulted ceilings cannot be inspected.

### **Crawlspace, Foundation, Structure & Basements**

Many of the dwellings structural elements and portions of it's mechanical systems are visible inside the Crawl Space. These include the foundation, portions of the structural framing, the distribution systems for electricity, plumbing and heating. Each accessible and visible component and system was examined for proper function, excessive wear or abnormal deterioration and general state of repair. It is not unusual to find occasional moisture and dampness in the Crawl Spaces and we advise annual inspections of this area.

Significant or frequent water accumulation can affect the structures foundation and support system and would indicate the need for further evaluation by professional drainage contractor. We advise to monitor your Crawl Space during the rainy season.